

PER. 75-26.57
MUS. 75-0.00

STRUCTURES 20' SPAN & UNDER

Stru No	Station	Proposed			Details on Sheet
		Type	Size	Length	
20	466+45.25	Pipe	53"x34"	80'	231

(B) STABILIZED BERMS

Mark	Station		Side	Stabilized Berm Sq. Yds.
	From	To		
1-B	458+00	469+00	Lt.	489
2-B	458+00	469+00	Rt.	489
Total				978

(D) DITCHES

Mark	Station		Side	L-10 Sodding Sq. Yds.
	From	To		
1-D	458+00	460+00	Lt.	134
2-D	463+75	465+00	Rt.	88
Total				222

(G) GUARD RAIL


Mark	Station		Side	I-15 Guard Rail 5 B (deep) Lin. Ft.
	From	To		
1-G	460+00	464+00	Rt.	400
Total				400

(U) PIPE UNDERDRAINS

Mark	Station		Side	I-4 6" Pipe Underdrain Lin. Ft.	I-4 8" Outlet Pipe Lin. Ft.	I-5 6"x45° Pipe Spec. Each
	From	To				
1-U	466+50	469+00	Lt.	252	10	1
Totals				252	10	1


(X) REMOVALS

Mark	Station		E-12 Pipe Removed Lin. Ft. 15" Under	E-8 Rem. & Disp. of Ex. Pav't Sq. Yds.
	From	To		
1-X	459+04		58	
2-X	467+15			2,444
3-X	458+00	469+00		2,444
Total			58	80

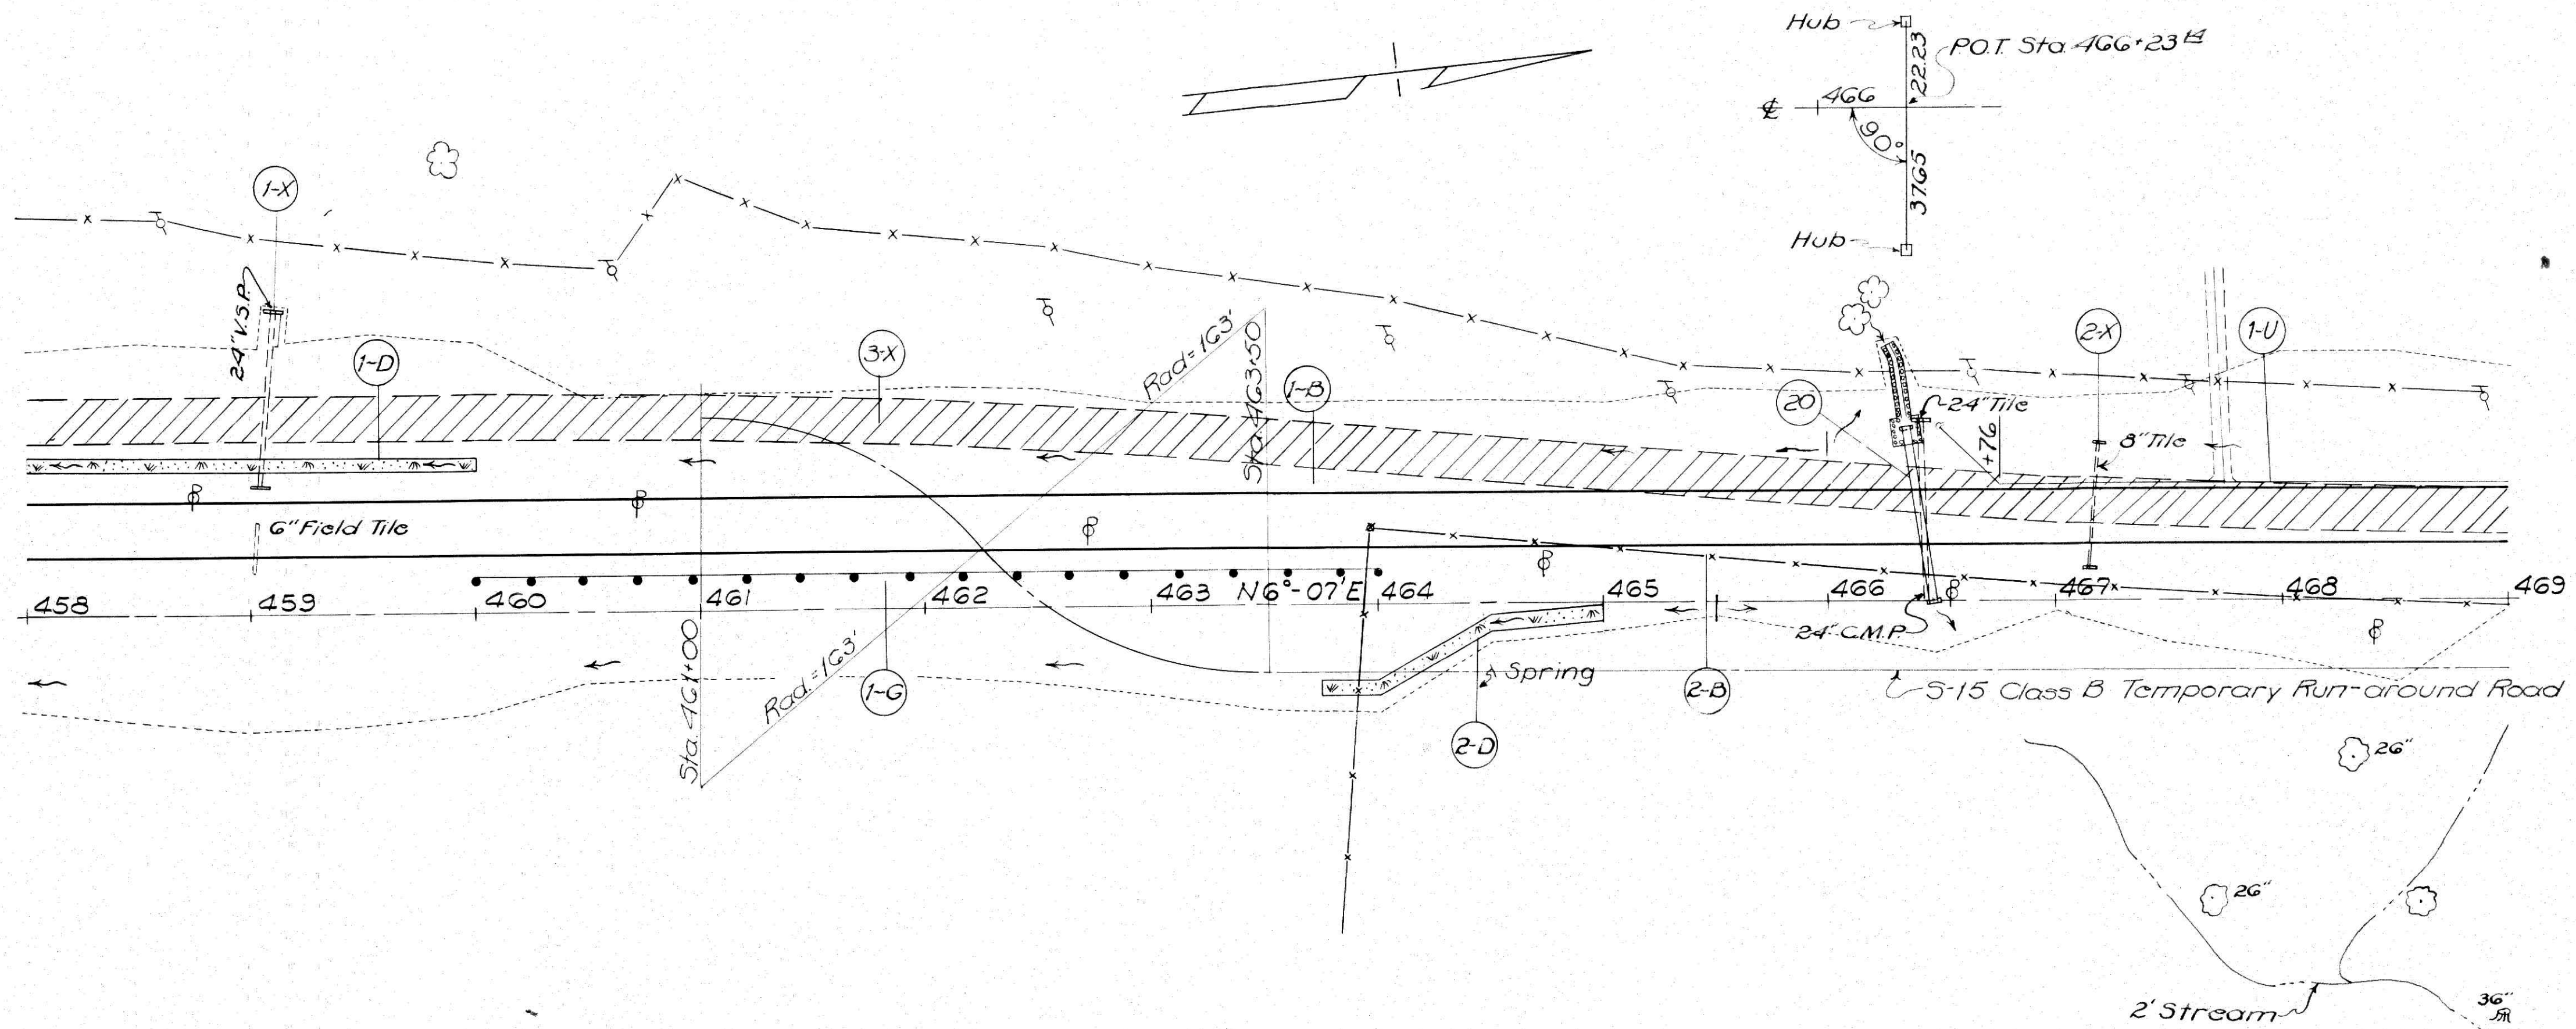

B.M. Spike in east side of power pole No. 731/T216
294' Lt. & Sta. 462+71.6 Elev. 721.10

B.M. Spike in southwest root of 28" Ash,
132' Rt. & Sta. 467+69 Elev. 724.15

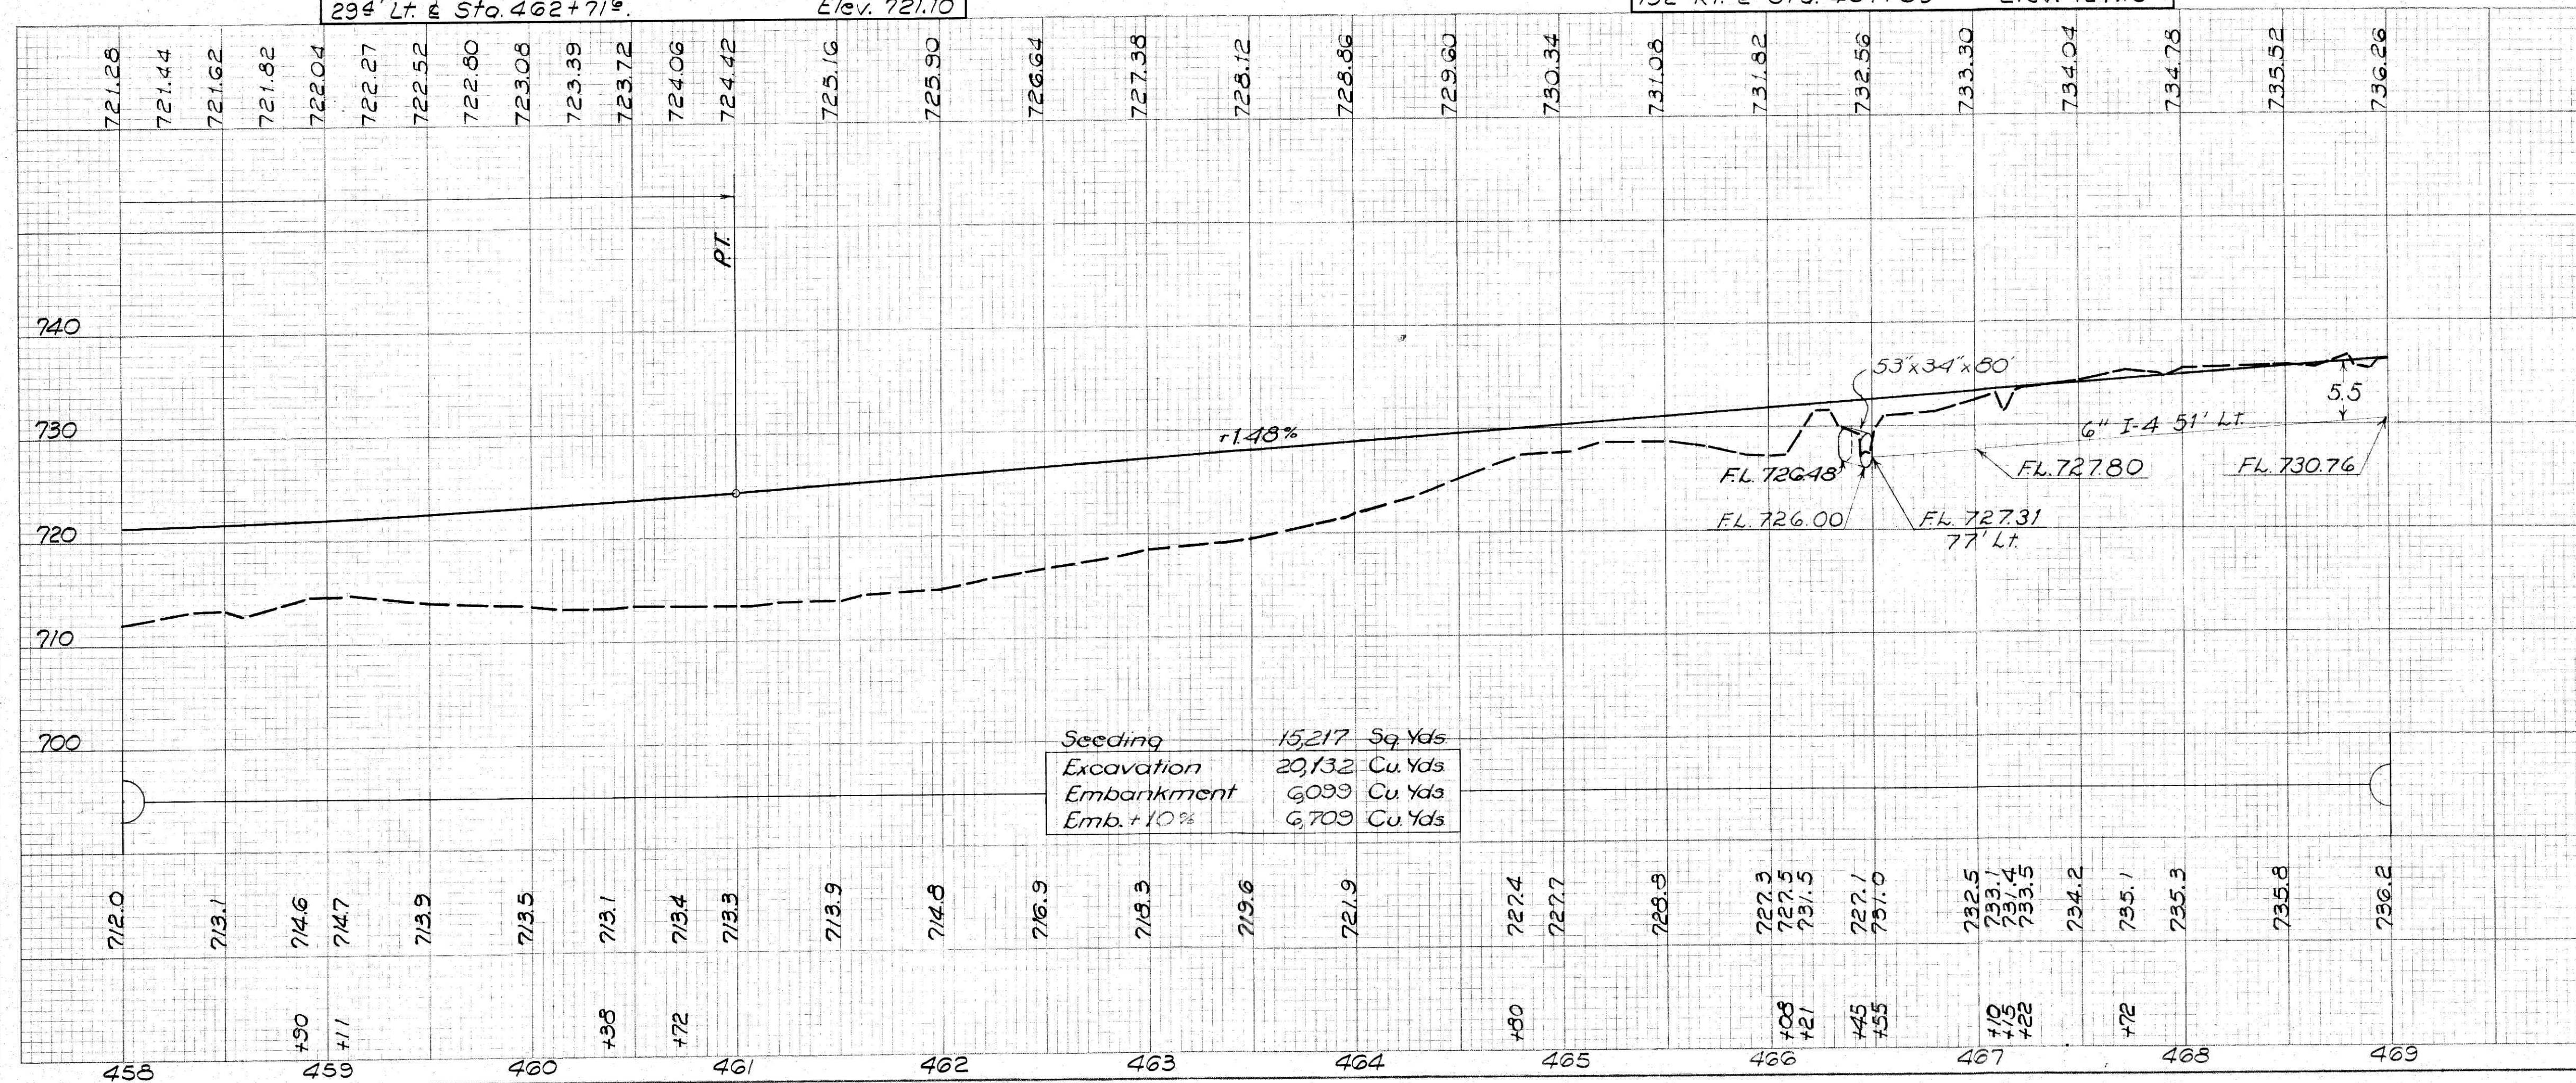

Seeding 15,217 Sq. Yds.
Excavation 20,132 Cu. Yds.
Embankment 6,033 Cu. Yds.
Emb. + 10% 6,709 Cu. Yds.