

40-40-20-13-000 C


Reduced copy, not to scale, Larger copy available in the Muskingum County Engineer's Map Dept.

- (A) Five Starr Farms LLC
O.R. Vol. 2457 Page 129
PPN 40-50-21-07-000
- (B) Terry L. and Candy Sue Stephens
O.R. Vol. 1959 Page 148
PPN 40-50-21-10-001
- (C) Charles M. Lane
O.R. Vol. 2676 Page 739
PPN 40-40-20-12-001
- (D) The Board of Trustees of Meigs Twp.
O.R. Vol. 2676 Page 739
PPN 40-40-20-11-000
- (E) Darryl K. and Betty J. Kinsler
O.R. Vol. 2154 Page 72
PPN 40-40-20-12-000

- Stone Found
- 1/2" Capped Pin Found "Claus"
- Aluminum Capped Pin Found "Harkness"
- 5/8" Rebar Found
- 5/8" Capped Pin Found "RLD"
- 5/8" Capped Pin Found "Harkness"
- 5/8" Capped Pin Found "Finley"
- 5/8" Capped Pin Found "Eastham"
- 5/8" Capped Pin Found "Snuffer"
- 5/8" Capped Pin Found "Galbraith"
- Railroad Spike Found
- Point

CURVE	ARC LENGTH	RADIUS	DELTA ANGLE	CHORD BEARING	CHORD LENGTH	TANGENT
C1	287.08	1024.56	14°56'08"	N 75°43'30" E	288.32	134.30
C2	92.81	1473.06	3°36'07"	N 81°23'30" E	92.88	46.32
C3	370.27	320.00	66°17'48"	N 75°23'54" E	349.96	208.99
C4	333.02	726.04	26°16'50"	N 71°00'50" W	330.11	169.49
C5	288.93	487.56	38°14'46"	N 76°29'48" W	295.22	154.88
C6	595.43	1293.00	26°23'08"	S 73°41'19" W	590.18	303.09
C7	293.99	1959.15	8°36'52"	S 49°33'30" W	293.71	147.27
C8	371.85	780.00	28°02'02"	S 87°52'27" W	368.18	189.73
C9	208.84	360.00	33°14'19"	N 81°29'23" W	205.93	107.45
C10	238.82	525.00	26°03'47"	N 77°54'07" W	236.76	121.51
C11	189.93	500.00	21°48'52"	S 78°13'38" W	188.79	96.12
C12	115.21	500.00	13°12'06"	S 73°46'45" W	114.98	57.96
C13	138.41	450.00	17°37'25"	S 89°21'32" W	137.87	69.76
C14	244.72	800.00	17°31'37"	N 73°03'57" W	243.77	123.32
C15	165.46	250.00	37°56'17"	N 83°15'47" W	162.46	85.49
C16	443.49	1293.00	19°39'08"	S 77°03'15" W	441.32	223.95
C17	151.94	1293.00	6°43'58"	S 63°51'45" W	151.85	76.06
C18	264.19	1200.00	12°36'51"	N 52°15'10" E	263.66	132.63

LINE	BEARING	DISTANCE
L1	S 87°31'00" E	55.00
L2	S 81°04'38" W	82.33
L3	S 03°54'02" W	104.86
L4	S 02°41'31" E	120.62
L5	S 07°04'04" E	182.09
L6	S 08°19'09" E	234.72
L7	S 63°30'35" W	189.89
L8	S 58°17'58" W	140.39
L9	S 50°25'23" W	93.41
L10	S 46°56'19" W	145.49
L11	N 76°02'48" E	140.41
L12	N 74°28'04" E	111.84
L13	N 80°49'18" E	167.50
L14	N 78°26'03" E	211.88
L15	N 65°36'00" E	82.80
L16	N 63°42'50" E	97.89
L17	N 05°49'48" W	227.20
L18	N 83°15'04" E	104.81
L19	N 89°03'40" E	45.18
L20	N 89°03'40" E	181.94
L21	N 89°03'40" E	181.94
L22	N 76°04'47" E	98.97

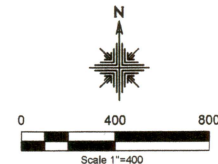

Meigs Township
S.E. Qtr. Section 20
S.W. & S.E. Qtr. Section 21
N.W. Qtr. Section 28
T-12 N; R-11 W
Muskingum County, Ohio

SURVEYED FOR: Mossy Oak Properties/ Five Starr Farms LLC

REFERENCES:


Deeds as shown

Survey on file at Muskingum County Engineer's Office.

Base of Bearing from Grid North, Ohio State Plane Coordinate System, South Zone, NAD 83.

DESCRIPTION
APPROVED

By: *[Signature]*

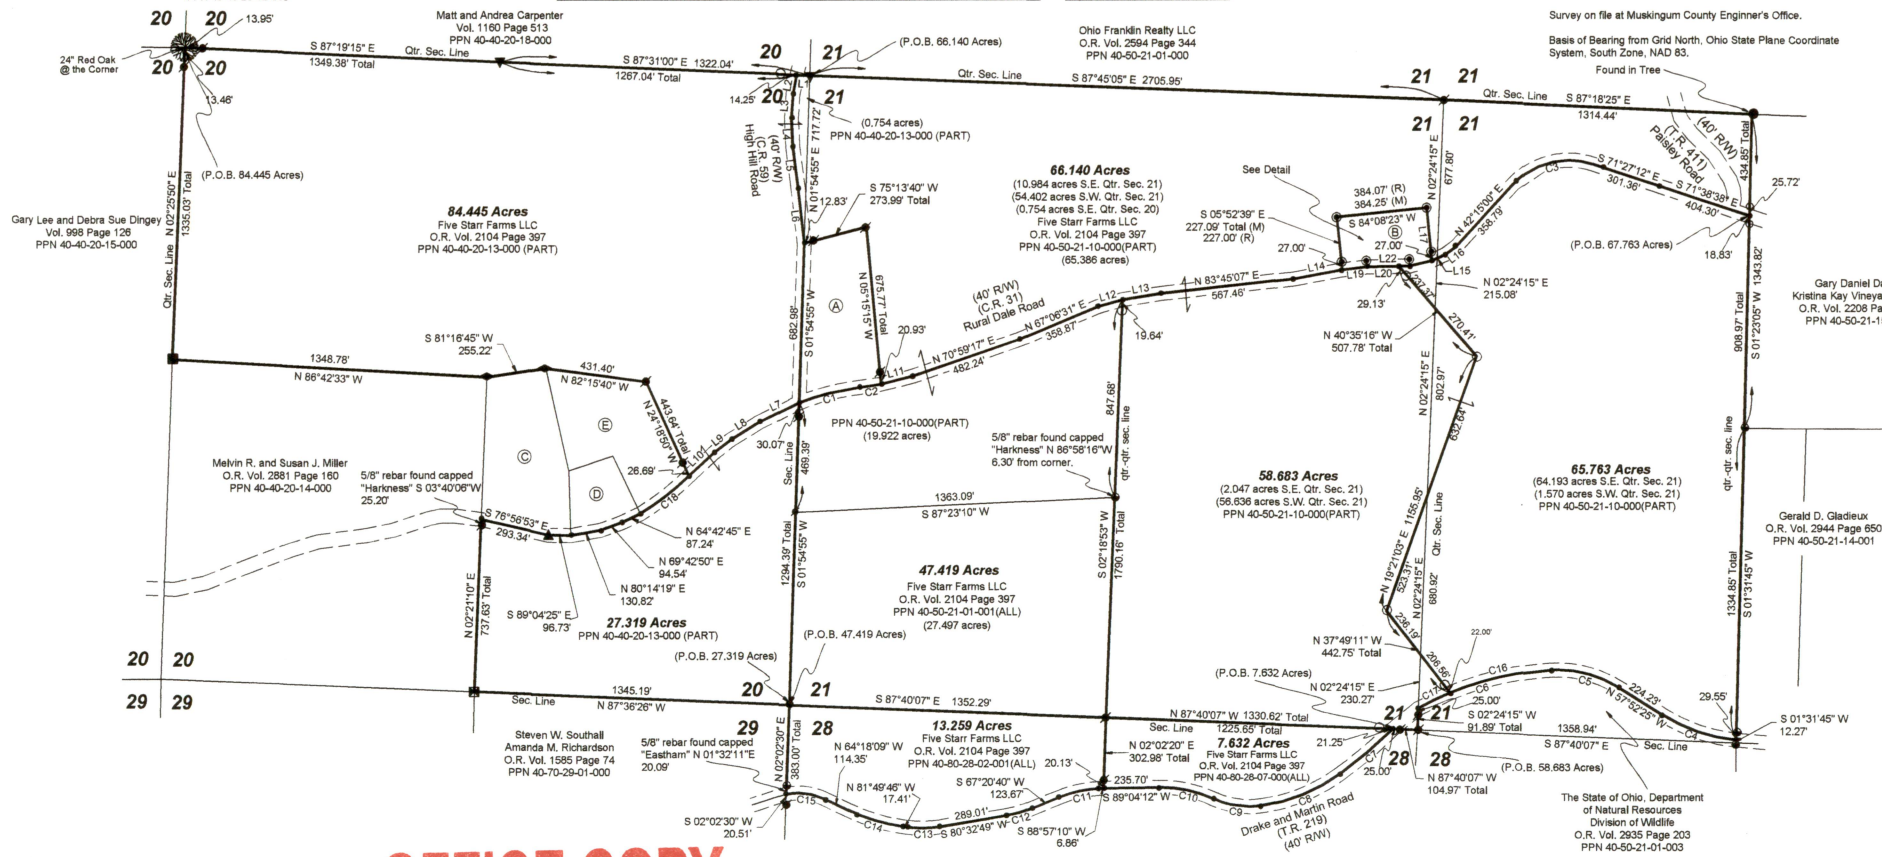

**OFFICE COPY
NOT RECORDABLE**

I certify this survey to be correct to the best of my knowledge.
Caleb Jerome Galbraith
Date: Feb 1, 2021
Job ID: 1421

The State of Ohio, Department of Natural Resources
Division of Wildlife
O.R. Vol. 2935 Page 203
PPN 40-80-28-02-000

Pioneer Surveying & Services, LLC.
5434 Township Road 377
Milledgeville, Ohio 44654
Phone: 330-231-0497
Email: caleb@pioneersurveyingandservices.com

