

## Re-Survey of Gary W. Dayton Lands

Situated in the State of Ohio, County of Muskingum, Township of Jackson, and being part of the Southeast Quarter of Section 7, Township 3, Range 9, United States Military Lands, and being all the lands presently owned by Gary W. Dayton as per Deed Record 945, Page 340, and being more particularly described as follows:

Beginning for reference at the southeast corner of Section 7, Township 3, Range 9, United States Military Lands;

Thence along the south line of Section 7, (by deed), North 89 degrees 29 minutes 09 seconds West, 368.94 feet to a point in the centerline of Hamby Hill Road, (Co. Rd. 38), and being the principal place of beginning;

Thence continuing along the south line of Section 7, and the north line of lands presently owned by J. L. Dreibelbiss,(OR 1154-610), North 89 degrees 29 minutes 09 seconds West 669.63 feet to an iron pin found on the northeast corner of lands presently owned by D. A. and E. J. Jacob,(OR 1160-745), passing an iron pin found at 28.61 feet;

Thence along the continuing along the south line of Section 7, and the north line of said Jacob lands, South 89 degrees 29 minutes 23 seconds West, 289.31 feet to an iron pin found on the southeast corner of lands presently owned by D. K. Levingston, (OR 1141-689);

Thence along the east line of said Levingston lands, and lands presently owned by T. R. and K. D. Bogner,(OR 1161-583), L. E. Heimberger,(OR 2359-41), and Tammac Corporation,(OR 2302-677, North 00 degrees 19 minutes 59 seconds East, 569.98 feet to an iron pin found on the south line of lands presently owned by C. B. Fairall,(OR 2194-908), passing iron pins found at 188.81 feet,(offline 0.23 feet perpendicular west), 329.39 feet, and 469.98 feet;

Thence along the south line of said Fairall lands, and the south line of lands presently owned by T. D. and A. M. Gee,(OR 1557-964), South 89 degrees 11 minutes 40 seconds East, 583.60 feet to the centerline of Hamby Hill Road,(Co. Rd. 38), passing an iron pin found at 387.62 feet, and an iron pin set at 553.60 feet;

Thence along the centerline of said road, South 33 degrees 21 minutes 20 seconds East, 676.66 feet to the principal place of beginning, containing 9.98 acres more or less.

Subject to all legal recorded easements and right of ways.

Iron pins set are 5\8 inch rebars , 30 inches long, with plastic identification caps.

Bearings are based on an assumed north meridian, and are for angular calculations only.

This description is written based on a field survey completed Feb. 13, 2012, by Jack D. Newcome, Reg. No. 7321.

**OFFICE COPY**  
**NOT RECORDABLE**

*Jack D. Newcome*  
Jack D. Newcome, Reg. No. 7321

\_\_\_\_\_  
Date

Parcel No.- All of: 29-10-07-21-000 +/- 9.98 Acres  
(+/- 0.31 Acres in R\W of Hamby Hill Road)



DESCRIPTION  
APPROVED

By: *[Signature]* 2/17/2012



**LEGEND**

- △ Railroad Spike Set
- Iron Pin Found
- ⊠ Stone Found
- Axle Found
- Iron Pipe Found
- ▲ Railroad Spike Found
- ⊙ Iron Pin Set, 5/8" rebar
- ⊠ Monument Found

**SITUATED IN:**

State of Ohio, County of Muskingum, Township of Jackson, and being part of the Southeast Quarter of Section 7, Township 3, Range 9, United States Military Lands

**BASIS OF BEARINGS**


Bearings are based on an assumed north meridian, and are for angular calculations only.

**REFERENCES**

- DR 945-340
- OR 1134-610
- OR 1180-745
- OR 1141-689
- OR 1161-583
- OR 2359-41
- OR 2302-677
- OR 1557-964

**PARCEL NO.**

All of: 29-10-07-21-000 +- 9.98 Acres  
(+- 0.31 Acres in R\W of Hamby Hill Road)

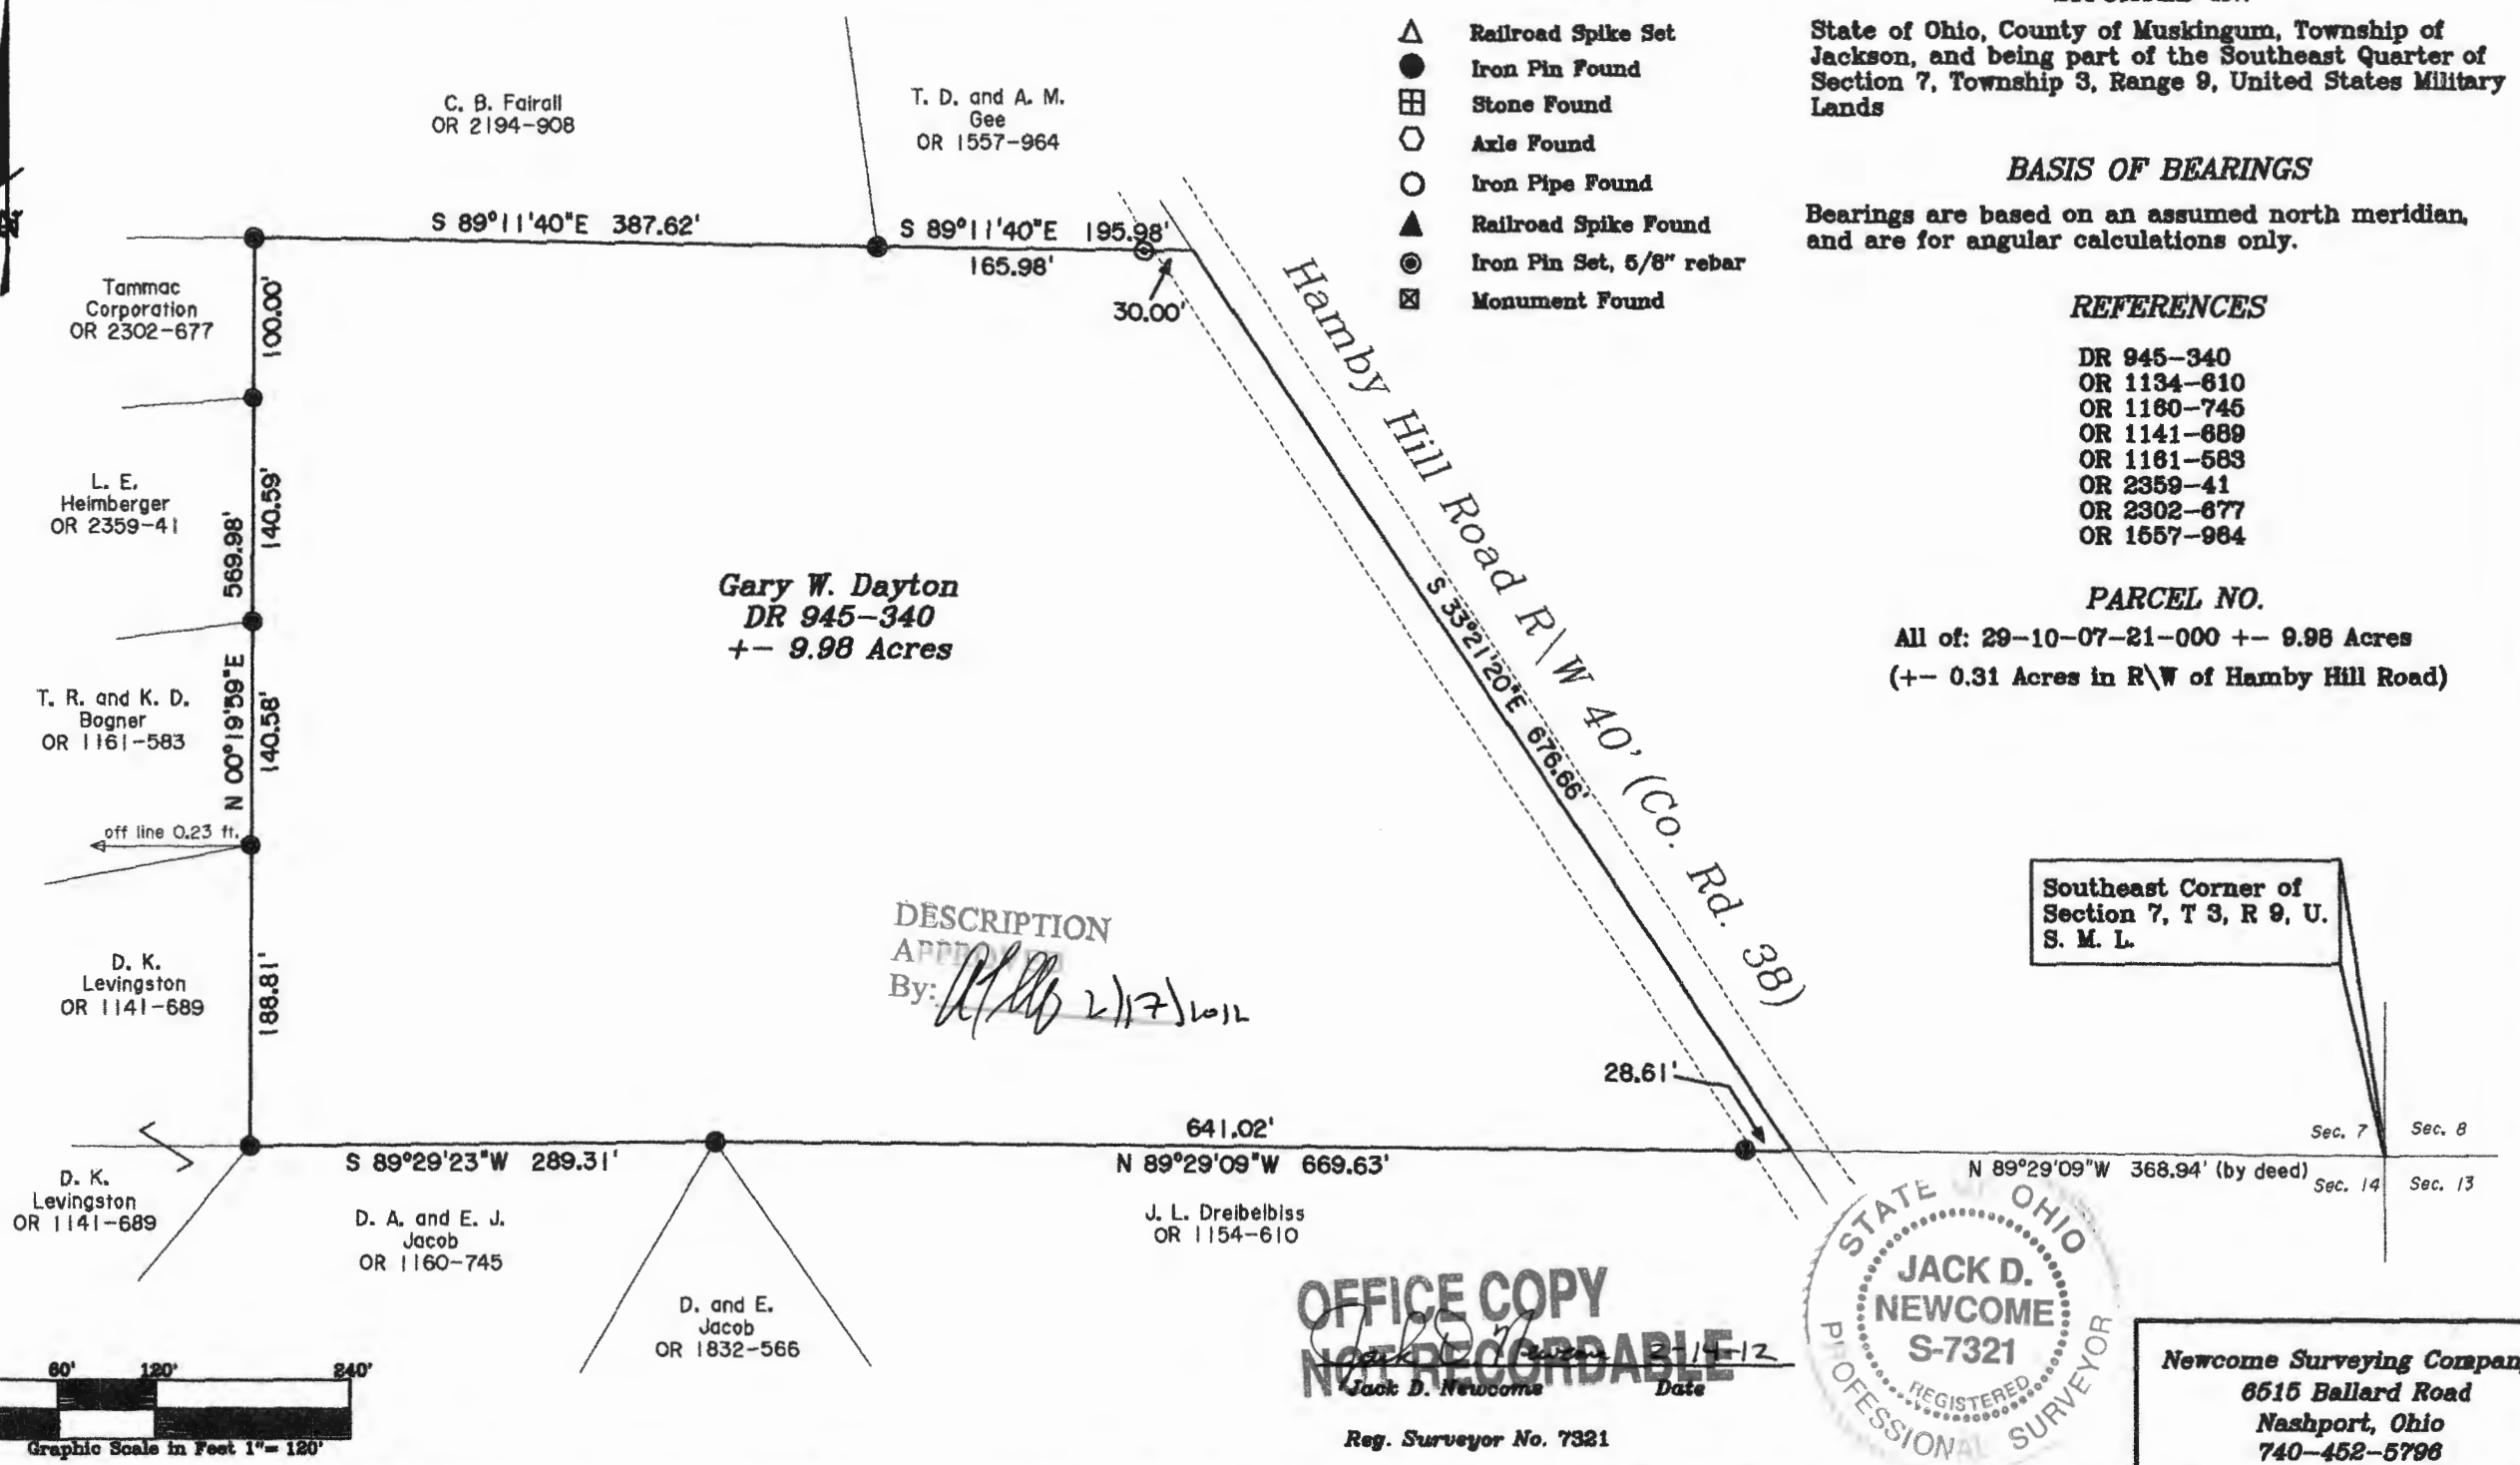

DESCRIPTION  
APPENDIX  
By: *[Signature]* 2/17/12

Southeast Corner of  
Section 7, T 3, R 9, U.  
S. M. L.



OFFICE COPY  
~~NOT RECORDABLE~~  
Jack D. Newcome  
Date 2/17/12

Reg. Surveyor No. 7321

Newcome Surveying Company  
6515 Ballard Road  
Nashport, Ohio  
740-452-5796

