

SITUATED IN

The State of Ohio, County of Muskingum, Township of Blue Rock, Northeast Quarter of Section 13, T12, R12 and also Township of Meigs, Northwest Quarter of Section 18, T12, R11.

BASIS OF BEARING

Bearings are based on State Plane Grid Coordinates, NAD83, Ohio South, per GPS Observation.

REFERENCES

* As Noted on Plat
www.muskingumcountyauditor.org
www.mceo.org
http://recorder.muskingumcounty.org
Previous surveys by: Biedenbach, Job No.:5054
Biedenbach, Job No.:2737
Baseline, Job No.:6467
Finley, 2012


DESCRIPTION
APPROVED

By: *[Signature]*

Brian Kelly McPeck
Reg. Surveyor No. 8517

This plat was prepared by McPeck Land Surveying, LLC in accordance with Chapter 4733-37 of the Administrative Code, and is intended to be used for the legal transfer of the property described and does not intend to describe all or any easements of record, nor encroachments unless otherwise intended.

**OFFICE COPY
NOT RECORDABLE**

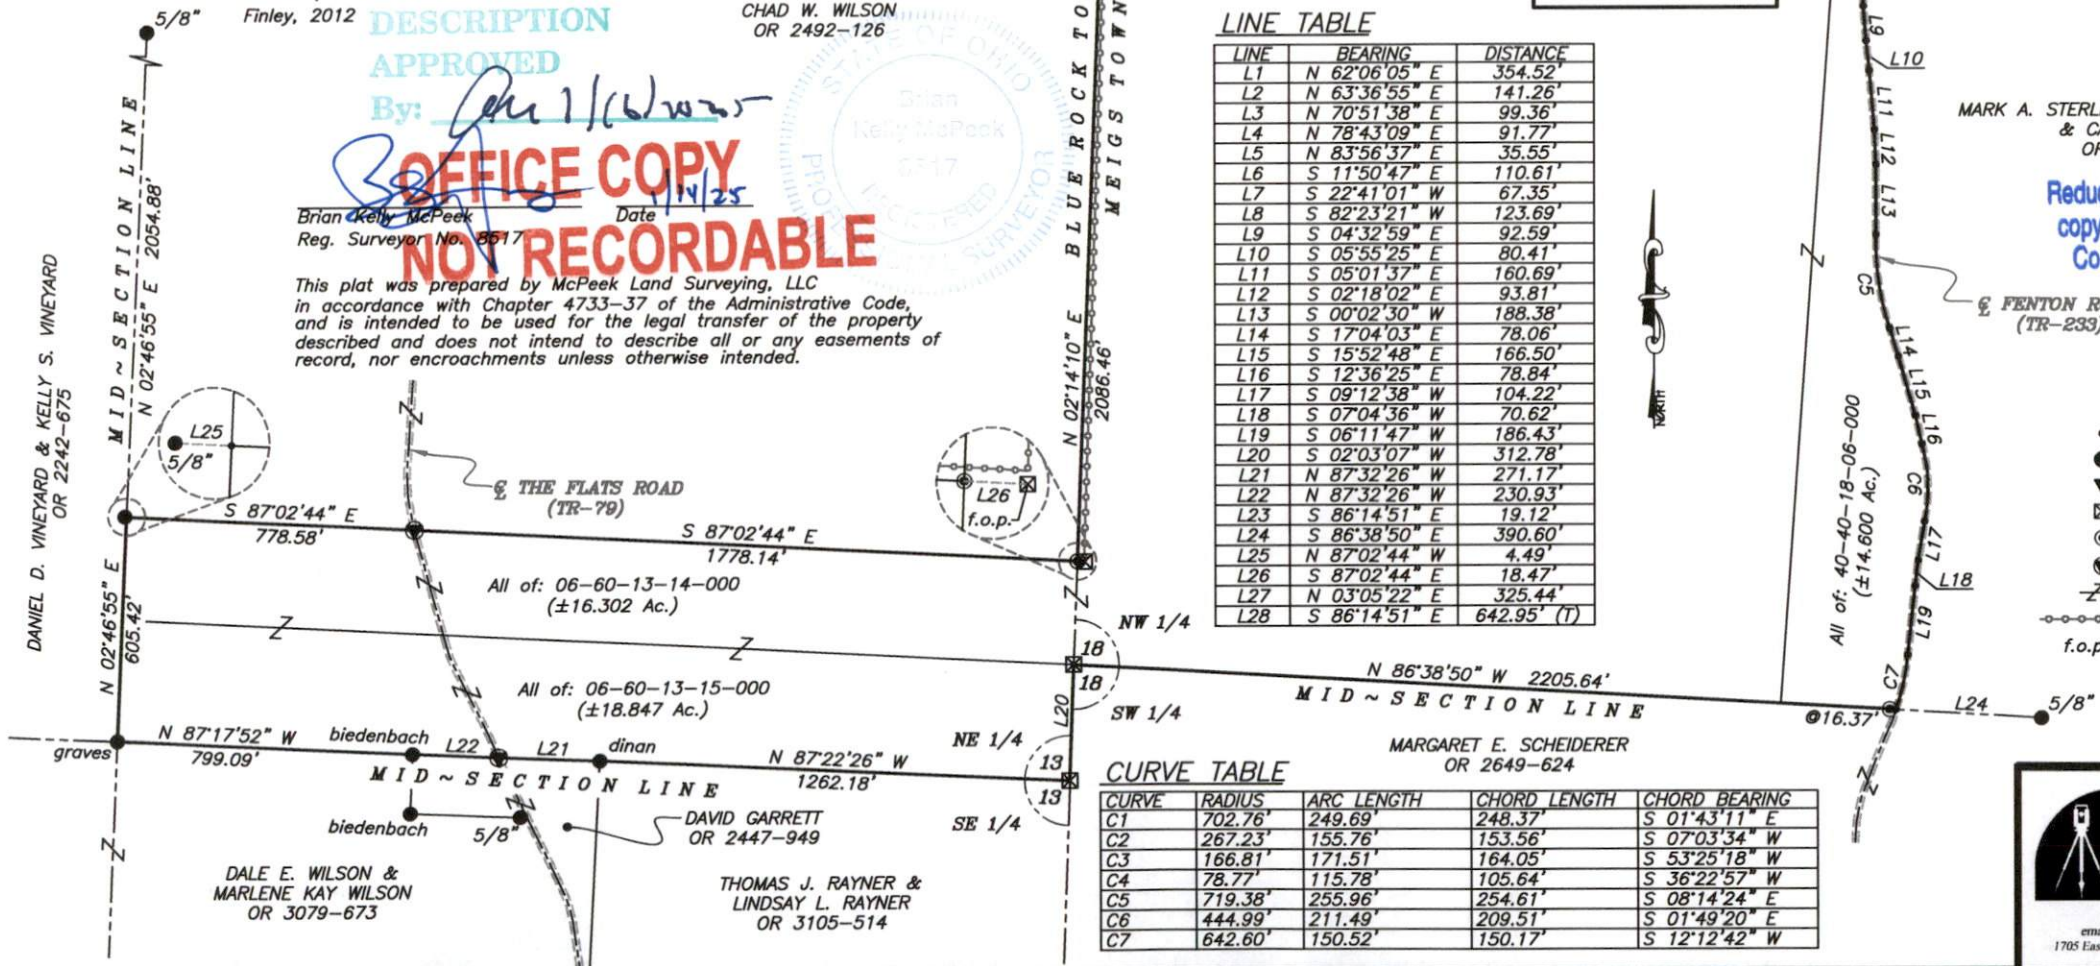


ROGER W. WILSON &
CAROLYN J. WILSON
OR 2976-540

CHAD W. WILSON &
STACY W. WILSON,
ETAL
OR 2964-702

ReSurvey

GRAPHIC SCALE

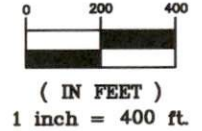

DAVID RAMEY
OR 2096-814
TOTAL ±169.342 Ac.

All of: 40-40-18-05-000
(±117.402 Ac.)

LINE TABLE

LINE	BEARING	DISTANCE
L1	N 62°06'05" E	354.52'
L2	N 63°36'55" E	141.26'
L3	N 70°51'38" E	99.36'
L4	N 78°43'09" E	91.77'
L5	N 83°56'37" E	35.55'
L6	S 11°50'47" E	110.61'
L7	S 22°41'01" W	67.35'
L8	S 82°23'21" W	123.69'
L9	S 04°32'59" E	92.59'
L10	S 05°55'25" E	80.41'
L11	S 05°01'37" E	160.69'
L12	S 02°18'02" E	93.81'
L13	S 00°02'30" W	188.38'
L14	S 17°04'03" E	78.06'
L15	S 15°52'48" E	166.50'
L16	S 12°36'25" E	78.84'
L17	S 09°12'38" W	104.22'
L18	S 07°04'36" W	70.62'
L19	S 06°11'47" W	186.43'
L20	S 02°03'07" W	312.78'
L21	N 87°32'26" W	271.17'
L22	N 87°32'26" W	230.93'
L23	S 86°14'51" E	19.12'
L24	S 86°38'50" E	390.60'
L25	N 87°02'44" W	4.49'
L26	S 87°02'44" E	18.47'
L27	N 03°05'22" E	325.44'
L28	S 86°14'51" E	642.95' (T)

CURVE TABLE

CURVE	RADIUS	ARC LENGTH	CHORD LENGTH	CHORD BEARING
C1	702.76'	249.69'	248.37'	S 01°43'11" E
C2	267.23'	155.76'	153.56'	S 07°03'34" W
C3	166.81'	171.51'	164.05'	S 53°25'18" W
C4	78.77'	115.78'	105.64'	S 36°22'57" W
C5	719.38'	255.96'	254.61'	S 08°14'24" E
C6	444.99'	211.49'	209.51'	S 01°49'20" E
C7	642.60'	150.52'	150.17'	S 12°12'42" W

MARK A. STERLING, CATHERINE STERLING
& CALEB STERLING
OR 2594-628

Reduced copy, not to scale, Larger
copy available in the Muskingum
County Engineer's Map Dept.

LEGEND

- Unmarked Point
- Iron Pin Found
- ▼ Railroad Spike Found
- ⊠ Stone Found
- ⊙ Iron Pin Set
- ⊙ Railroad Spike Set
- Property Hook
- Ex. Fence
- f.o.p. Found Out Of Position

**MCPECK
LAND
SURVEYING** LLC
www.mcpecklandsurveying.com
email: brian@mcpecklandsurveying.com
1705 East Pike, * Zanesville, Oh 43701 * 740.704.6073