

Reduced copy, not to scale, Larger
copy available in the Muskingum
County Engineer's Map Dept.

DESCRIPTION
APPROVED


By: *[Signature]*

- (A) Five Starr Farms LLC
O.R. Vol. 2467 Page 129
PPN 40-50-21-07-000
- (B) Terry L. and Candy Sue Stephens
O.R. Vol. 1859 Page 148
PPN 40-50-21-10-001
- (C) Charles M. Lane
O.R. Vol. 2676 Page 739
PPN 40-40-20-12-001
- (D) The Board of Trustees of Meigs Twp.
Vol. 767 Page 251
PPN 40-40-20-11-000
- (E) Darryl K. and Betty J. Kinser
O.R. Vol. 2154 Page 72
PPN 40-40-20-12-000

- Stone Found
- 1/2" Capped Pin Found "Claus"
- Aluminum Capped Pin Found "Harkness"
- 5/8" Rebar Found
- 5/8" Capped Pin Found "RLD"
- 5/8" Capped Pin Found "Harkness"
- 5/8" Capped Pin Found "Finley"
- 5/8" Capped Pin Found "Eastham"
- 5/8" Capped Pin Found "Snouffer"
- 5/8" Capped Pin Set "Galbraith"
- ▲ Railroad Spike Found
- Point

CURVE	ARC LENGTH	RADIUS	DELTA ANGLE	CHORD BEARING	CHORD LENGTH	TANGENT
C1	267.06	1024.56	14°56'06"	N 75°43'30" E	266.32	134.30
C2	92.61	1473.06	3°36'07"	N 81°23'30" E	92.59	46.37
C3	370.27	320.00	96°17'48"	N 75°23'54" E	348.99	208.99
C4	333.02	728.04	28°16'50"	N 71°00'50" W	330.11	169.49
C5	299.93	487.56	35°14'46"	N 75°29'48" W	295.22	154.88
C6	595.43	1293.00	26°23'06"	S 73°41'19" W	590.18	303.09
C7	293.99	1959.15	8°35'52"	S 49°53'30" W	293.71	147.27
C8	371.85	760.00	28°02'02"	S 87°52'27" W	368.16	189.73
C9	208.84	360.00	33°14'19"	N 81°29'23" W	205.63	107.45
C10	236.82	525.00	26°03'47"	N 77°54'07" W	236.76	121.51
C11	189.93	600.00	21°48'52"	S 78°13'36" W	188.79	96.12
C12	115.21	500.00	13°12'09"	S 73°56'45" W	114.96	57.96
C13	136.41	450.00	17°37'25"	S 89°21'32" W	137.87	69.79
C14	244.72	850.00	17°31'37"	N 73°03'57" W	243.70	123.32
C15	185.46	250.00	37°58'17"	N 83°15'47" W	182.46	85.89
C16	443.49	1293.00	19°39'08"	S 77°03'15" W	441.32	223.95
C17	151.94	1293.00	8°43'58"	S 63°51'48" W	151.88	76.08
C18	264.19	1200.00	11°36'51"	N 52°18'10" E	263.66	132.63

LINE	BEARING	DISTANCE
L1	S 87°31'00" E	55.00
L2	S 11°04'38" W	82.33
L3	S 03°44'02" W	104.68
L4	S 02°41'31" E	120.62
L5	S 07°04'04" E	182.09
L6	S 08°19'06" E	234.72
L7	S 63°30'35" W	189.69
L8	S 58°17'58" W	140.39
L9	S 52°25'53" W	93.41
L10	S 48°56'19" W	145.49
L11	N 76°02'48" E	140.41
L12	N 74°28'04" E	111.84
L13	N 80°48'18" E	187.50
L14	N 79°26'03" E	211.86
L15	N 65°36'00" E	62.80
L16	N 53°42'50" E	57.95
L17	N 09°48'45" W	227.20
L18	S 83°15'04" E	104.81
L19	N 89°03'40" E	138.76
L20	N 89°03'40" E	45.18
L21	N 89°03'40" E	181.94
L22	N 76°04'47" E	98.97

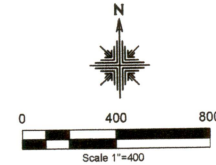

Meigs Township
S.E. Qtr. Section 20
S.W. & S.E. Qtr. Section 21
N.W. Qtr. Section 28
T-12 N; R-11 W
Muskingum County, Ohio

SURVEYED FOR: Mossey Oak Properties/ Five Starr Farms LLC


REFERENCES:

Deeds as shown


Survey on file at Muskingum County Engineer's Office.

Basis of Bearing from Grid North, Ohio State Plane Coordinate
System, South Zone, NAD 83.

Found in Tree

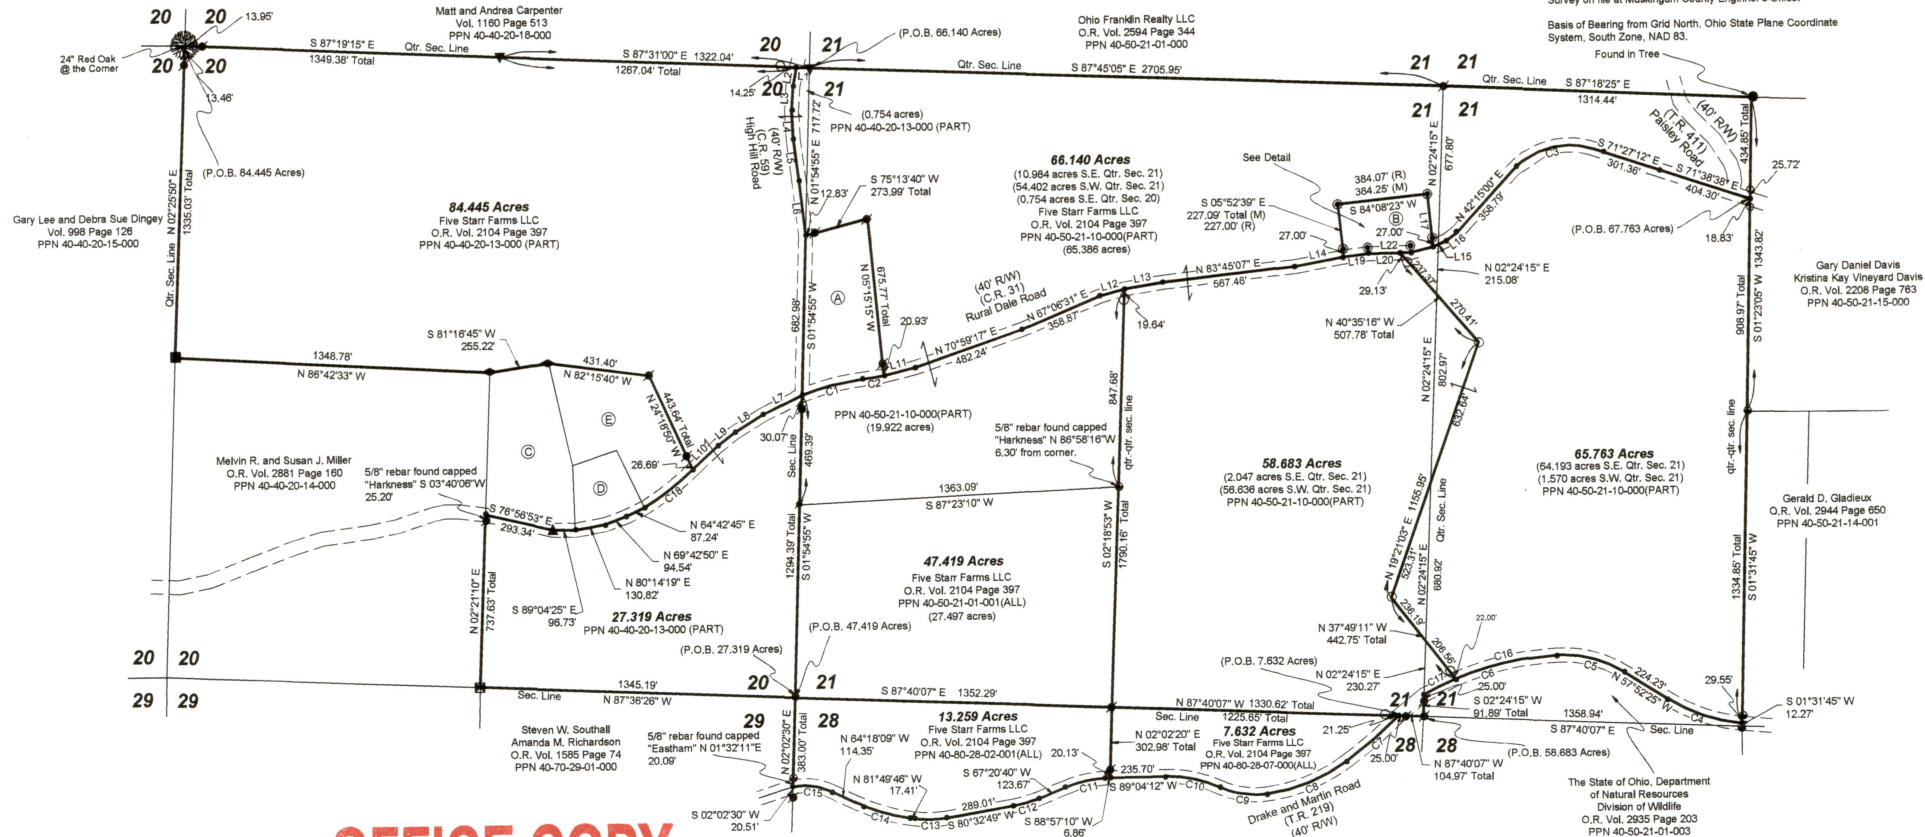

OFFICE COPY
NOT RECORDABLE

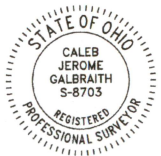

Caleb Jerome Galbraith
Date Feb 1, 2021
Job ID: 1421

P.S. 8703

The State of Ohio, Department
of Natural Resources
Division of Wildlife
O.R. Vol. 2935 Page 203
PPN 40-80-28-02-000

Pioneer Surveying & Services, LLC.
5434 Township Road 377
Millerstown, Ohio 44654
Phone: 330-231-0497
Email: caleb@pioneersurveyingandservices.com

