


Reduced copy, not to scale, Larger copy available in the Muskingum County Engineer's Map Dept.

- (A) Five Starr Farms LLC
O.R. Vol. 2457 Page 129
PPN 40-50-21-07-000
- (B) Terry L. and Candy Sue Stephens
O.R. Vol. 1859 Page 148
PPN 40-50-21-10-001
- (C) Charles M. Lane
O.R. Vol. 2876 Page 739
PPN 40-40-20-12-001
- (D) The Board of Trustees of Meigs Twp.
Vol. 787 Page 251
PPN 40-40-20-11-000
- (E) Darryl K. and Betty J. Kinser
O.R. Vol. 2154 Page 72
PPN 40-40-20-12-000

- Stone Found
- 1/2" Capped Pin Found "Claus"
- Aluminum Capped Pin Found "Harkness"
- 5/8" Rebar Found
- 5/8" Capped Pin Found "RLD"
- 5/8" Capped Pin Found "Harkness"
- 5/8" Capped Pin Found "Finley"
- 5/8" Capped Pin Found "Eastham"
- 5/8" Capped Pin Found "Snoutler"
- 5/8" Capped Pin Set "Galbraith"
- Railroad Spike Found
- Point

CURVE	ARC LENGTH	RADIUS	DELTA ANGLE	CHORD BEARING	CHORD LENGTH	TANGENT
C1	267.08	1024.56	14°56'06"	N 75°43'30" E	266.32	134.30
C2	92.61	1473.08	3°36'07"	N 81°23'30" E	92.39	48.32
C3	370.27	320.07	86°17'48"	N 75°23'54" E	348.95	208.99
C4	333.02	726.04	26°16'50"	N 71°00'50" W	330.11	169.49
C5	299.93	487.58	35°14'48"	N 75°29'48" W	295.22	154.88
C6	695.43	1293.01	28°23'08"	S 73°41'19" W	594.15	303.09
C7	263.99	1959.15	8°35'52"	S 49°33'30" W	263.71	147.27
C8	371.88	760.00	28°02'02"	S 87°52'27" W	368.15	189.73
C9	208.84	360.00	33°14'19"	N 51°29'23" W	205.93	107.45
C10	238.82	525.00	28°03'47"	N 77°54'07" W	236.76	121.51
C11	189.93	500.00	21°45'52"	S 78°13'36" E	188.79	96.12
C12	115.21	500.00	13°12'09"	S 73°56'45" W	114.99	57.89
C13	138.41	450.00	17°43'28"	S 69°11'32" W	137.87	67.87
C14	244.72	800.00	17°31'37"	N 73°03'57" W	243.77	123.32
C15	165.46	250.00	37°55'17"	N 83°15'47" W	162.46	85.89
C16	443.49	1293.01	19°39'08"	S 77°03'15" W	441.32	223.95
C17	151.94	1293.01	18°43'58"	S 63°41'48" W	151.85	76.99
C18	264.19	1200.00	12°38'51"	N 52°15'10" E	263.66	132.63

LINE	BEARING	DISTANCE
L1	S 87°31'00" E	55.00
L2	S 110°36'36" W	82.33
L3	S 03°54'02" W	104.66
L4	S 02°41'31" E	120.62
L5	S 07°04'04" E	182.09
L6	S 08°19'09" E	234.72
L7	S 63°30'35" W	189.69
L8	S 58°17'58" W	140.39
L9	S 52°25'53" W	93.41
L10	S 48°56'19" W	145.49
L11	N 76°02'48" E	140.41
L12	N 74°28'04" E	111.84
L13	N 80°49'18" E	187.50
L14	N 79°26'03" E	211.88
L15	N 65°36'00" E	52.80
L16	N 53°42'50" E	57.85
L17	N 05°46'45" W	227.20
L18	N 83°15'04" E	104.81
L19	N 89°03'40" E	136.76
L20	N 89°03'40" E	45.18
L21	N 89°03'40" E	181.94
L22	N 76°04'47" E	98.97

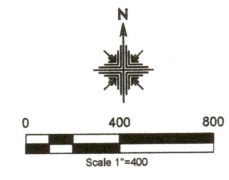


Meigs Township
S.E. Qtr. Section 20
S.W. & S.E. Qtr. Section 21
N.W. Qtr. Section 28
T-12 N; R-11 W
Muskingum County, Ohio

SURVEYED FOR: Mossey Oak Properties/ Five Starr Farms LLC
REFERENCES:
Deeds as shown
Survey on file at Muskingum County Engineer's Office.
Basis of Bearing from Grid North, Ohio State Plane Coordinate System, South Zone, NAD 83.
Found in Tree

DESCRIPTION
APPROVED

By: *AJ 3/1/2021*

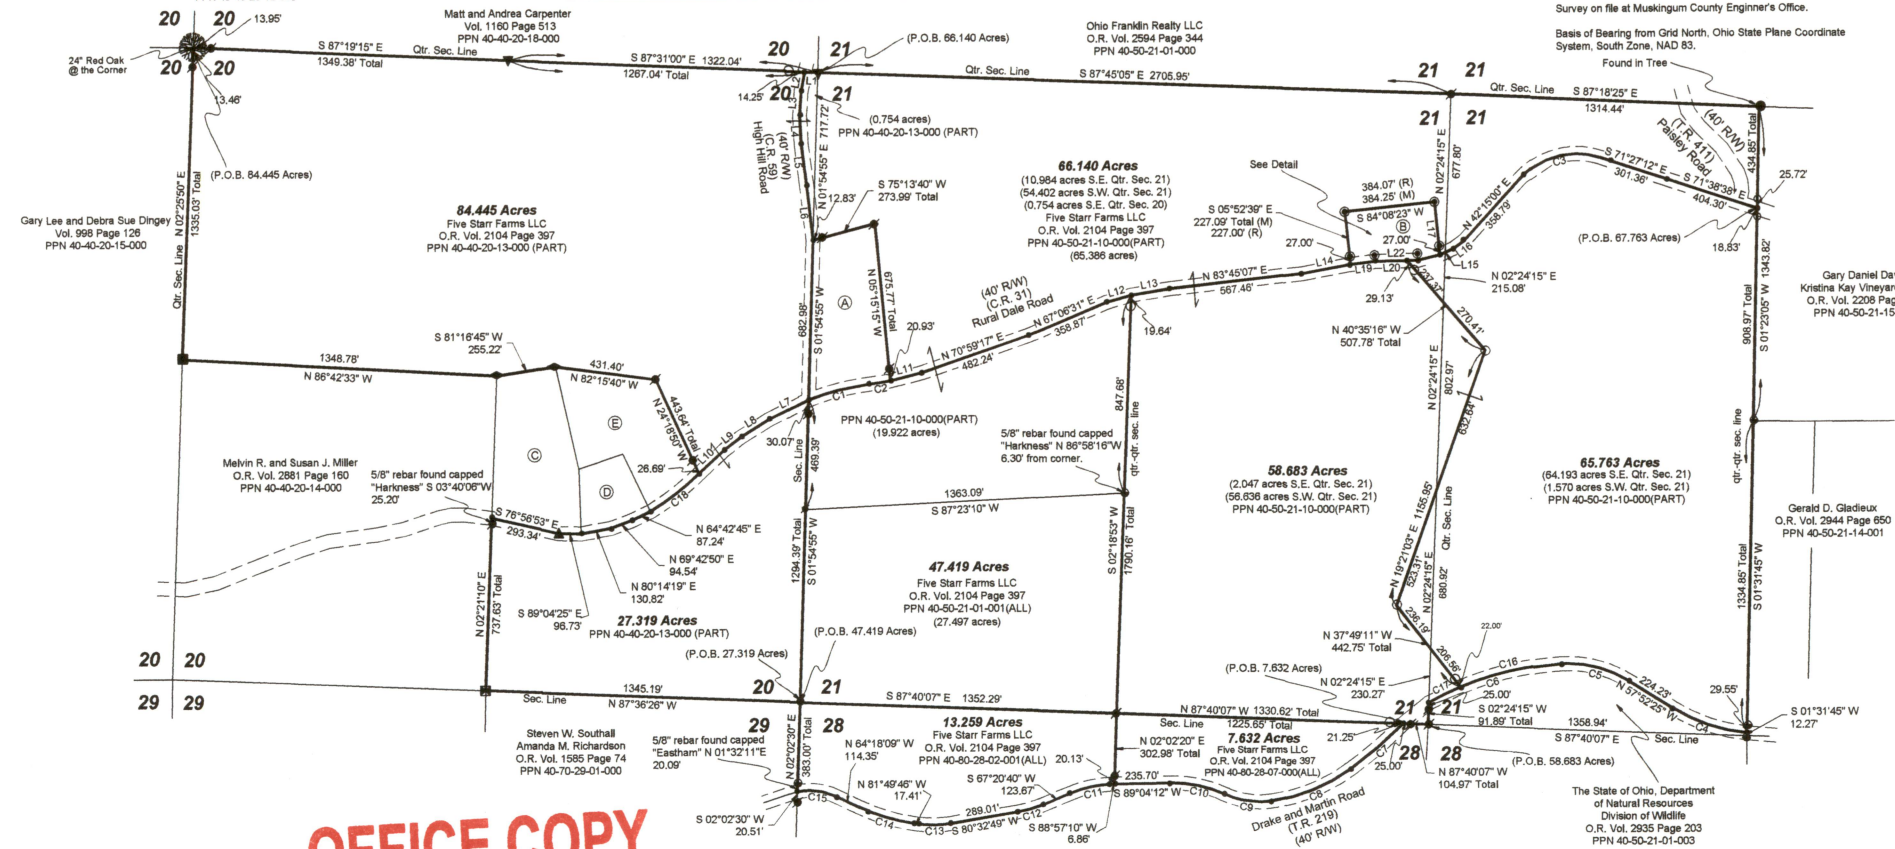

**OFFICE COPY
NOT RECORDABLE**



Caleb Jerome Galbraith
Date: Feb 1, 2021
Job ID: 1421

The State of Ohio, Department of Natural Resources
Division of Wildlife
O.R. Vol. 2935 Page 203
PPN 40-80-28-02-000

The State of Ohio, Department of Natural Resources
Division of Wildlife
O.R. Vol. 2935 Page 203
PPN 40-50-21-01-003

Pioneer Surveying & Services, LLC.
5434 Township Road 377
Millersburg, Ohio 44654
Phone: 330-231-0497
Email: caleb@pioneersurveyingandservices.com

