



40-50-21-10-004 E
40-40-20-13-002 E

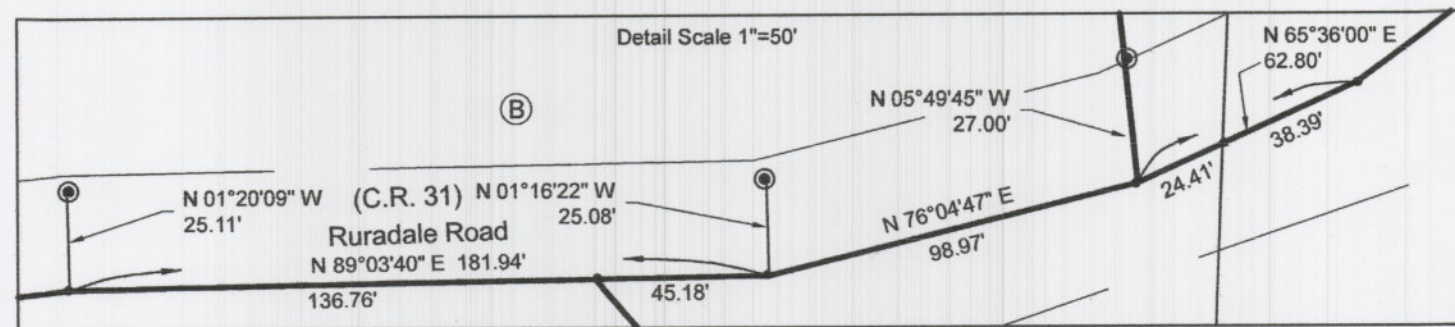

LINE	BEARING	DISTANCE
L1	S 87°31'00" E	55.00'
L2	S 11°04'38" W	82.33'
L3	S 03°54'02" W	104.66'
L4	S 02°41'31" E	120.62'
L5	S 07°04'04" E	182.09'
L6	S 06°19'09" E	234.72'
L7	S 63°30'35" W	189.69'
L8	S 58°17'58" W	140.39'
L9	S 52°25'53" W	93.41'
L10	S 46°56'19" W	145.49'
L11	N 76°02'48" E	140.41'
L12	N 74°28'04" E	111.84'
L13	N 80°49'18" E	167.50'
L14	N 79°26'03" E	211.85'
L15	N 65°36'00" E	62.80'
L16	N 53°42'50" E	57.85'
L17	N 05°49'45" W	227.20'
L18	N 83°15'04" E	104.81'
L19	N 89°03'40" E	136.76'
L20	N 89°03'40" E	45.18'
L21	N 89°03'40" E	181.94'
L22	N 76°04'47" E	98.97'

CURVE	ARC LENGTH	RADIUS	DELTA ANGLE	CHORD BEARING	CHORD LENGTH	TANGENT
C1	267.08'	1024.56'	14°56'08"	N 75°43'30" E	266.32'	134.30'
C2	92.61'	1473.06'	3°36'07"	N 81°23'30" E	92.59'	46.32'
C3	370.27'	320.00'	66°17'48"	N 75°23'54" E	349.96'	208.99'
C4	333.02'	726.04'	26°16'50"	N 71°00'50" W	330.11'	169.49'
C5	299.93'	487.56'	35°14'46"	N 75°29'48" W	295.22'	154.88'
C6	595.43'	1293.00'	26°23'06"	S 73°41'19" W	590.18'	303.09'
C7	293.99'	1959.15'	8°35'52"	S 49°33'30" W	293.71'	147.27'
C8	371.86'	760.00'	28°02'02"	S 67°52'27" W	368.16'	189.73'
C9	208.84'	360.00'	33°14'19"	N 81°29'23" W	205.93'	107.45'
C10	238.82'	525.00'	26°03'47"	N 77°54'07" W	236.76'	121.51'
C11	189.93'	500.00'	21°45'52"	S 78°13'36" W	188.79'	96.12'
C12	115.21'	500.00'	13°12'09"	S 73°56'45" W	114.96'	57.86'
C13	138.41'	450.00'	17°37'25"	S 69°21'32" W	137.87'	69.76'
C14	244.72'	800.00'	17°31'37"	N 73°03'57" W	243.77'	123.32'
C15	165.46'	250.00'	37°55'17"	N 83°15'47" W	162.46'	85.89'
C16	443.49'	1293.00'	19°39'08"	S 77°03'15" W	441.32'	223.95'
C17	151.94'	1293.00'	6°43'58"	S 63°51'45" W	151.85'	76.06'
C18	264.19'	1200.00'	12°36'51"	N 52°15'10" E	263.66'	132.63'

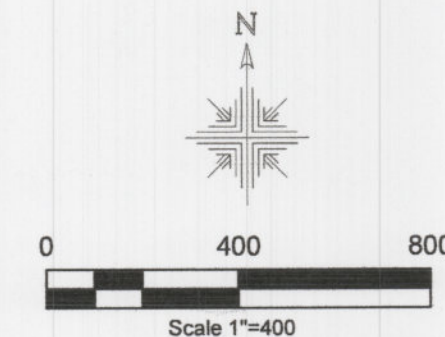


Meigs Township
S.E. Qtr. Section 20
S.W. & S.E. Qtr. Section 21
N.W. Qtr. Section 28
T-12 N; R-11 W
Muskingum County, Ohio

SURVEYED FOR: Mossy Oak Properties/ Five Starr Farms LLC
REFERENCES:
Deeds as shown
Survey on file at Muskingum County Engineer's Office.
Basis of Bearing from Grid North, Ohio State Plane Coordinate System, South Zone, NAD 83.

- (A) Five Starr Farms LLC
O.R. Vol. 2457 Page 129
PPN 40-50-21-07-000
- (B) Terry L. and Candy Sue Stephens
O.R. Vol. 1859 Page 148
PPN 40-50-21-10-001
- (C) Charles M. Lane
O.R. Vol. 2676 Page 739
PPN 40-40-20-12-001
- (D) The Board of Trustees of Meigs Twp.
Vol. 767 Page 251
PPN 40-40-20-11-000
- (E) Darryl K. and Betty J. Kinsler
O.R. Vol. 2154 Page 72
PPN 40-40-20-12-000


- Stone Found
- 1/2" Capped Pin Found "Claus"
- Aluminum Capped Pin Found "Harkness"
- 5/8" Rebar Found
- 5/8" Capped Pin Found "RLD"
- 5/8" Capped Pin Found "Harkness"
- 5/8" Capped Pin Found "Finley"
- 5/8" Capped Pin Found "Eastham"
- 5/8" Capped Pin Found "Snouffer"
- 5/8" Capped Pin Set "Galbraith"
- Railroad Spike Found
- Point

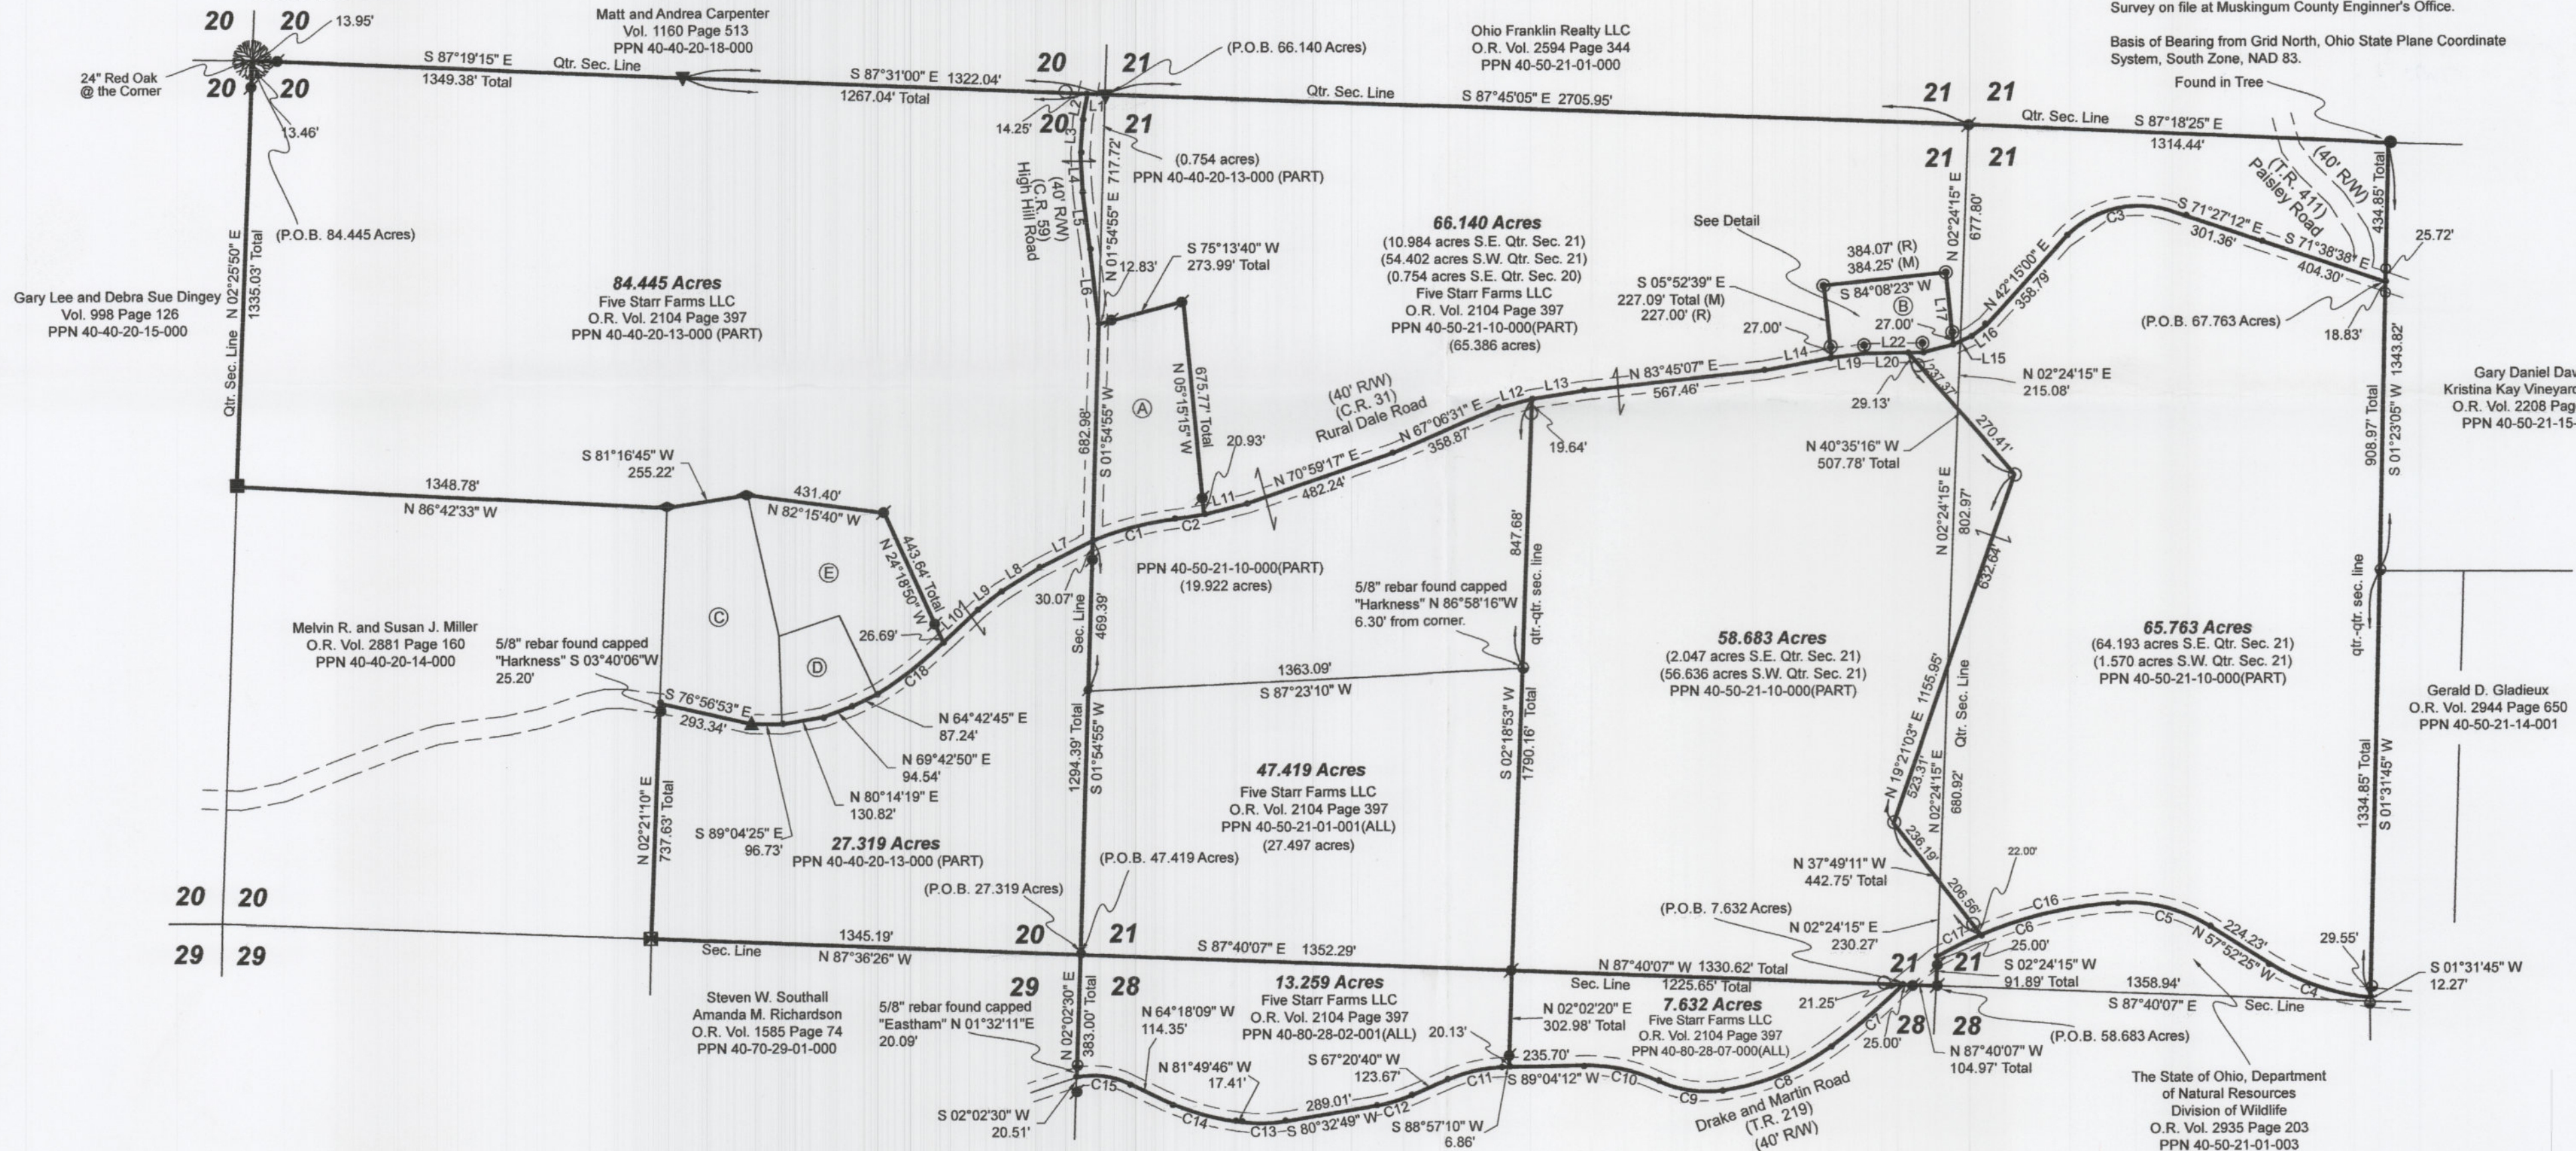

I certify this survey to be correct to the best of my knowledge.
OFFICE COPY NOT RECORDABLE
Caleb Jerome Galbraith P.S. 8703
Date: Feb 1, 2021
Job ID: 1421

The State of Ohio, Department of Natural Resources
Division of Wildlife
O.R. Vol. 2935 Page 203
PPN 40-80-28-02-000

Pioneer Surveying & Services, LLC.
5434 Township Road 377
Millersburg, Ohio 44654
Phone: 330-231-0497
Email: caleb@pioneersurveyingandservices.com

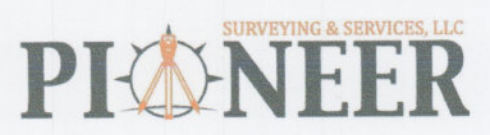

APPROVED
MUSKINGUM COUNTY
PLANNING COMMISSION DIRECTOR
Date

DESCRIPTION
APPROVED
By: [Signature]