



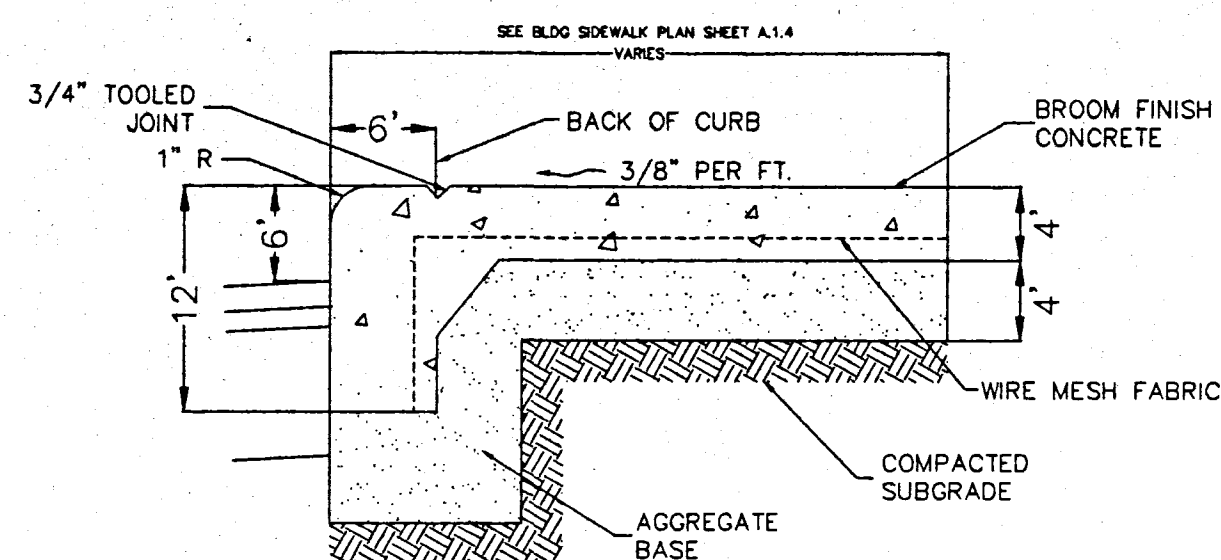


SIDEWALK DETAIL

SCALE: NONE

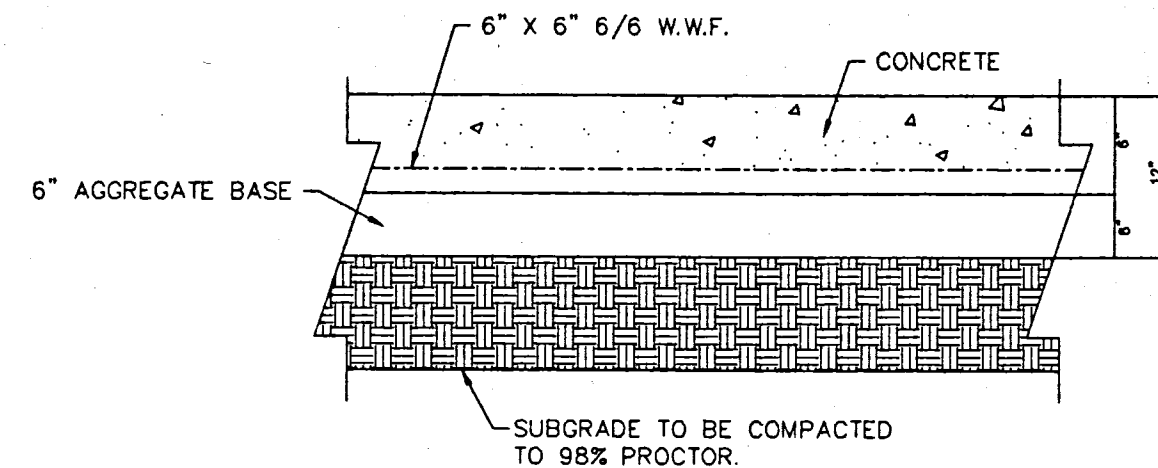


CONCRETE DUMPSTER PAD DETAIL

SCALE: NONE

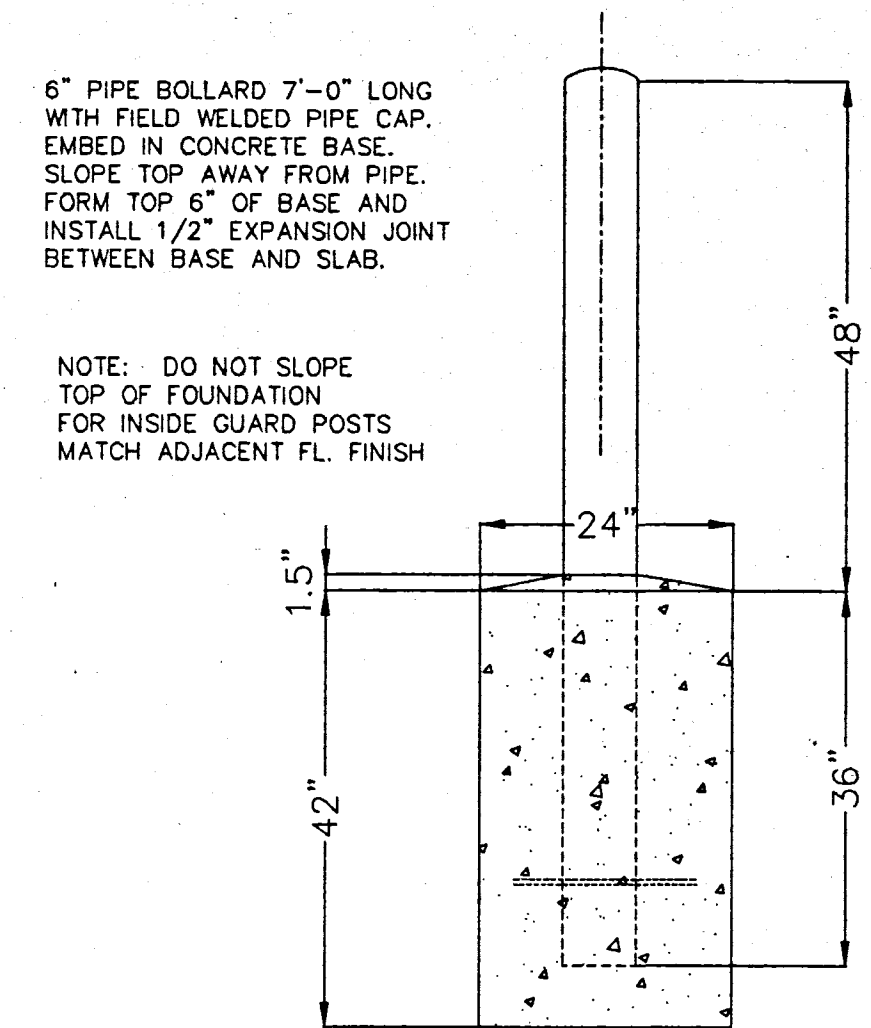


PIPE BOLLARD

SCALE: NONE

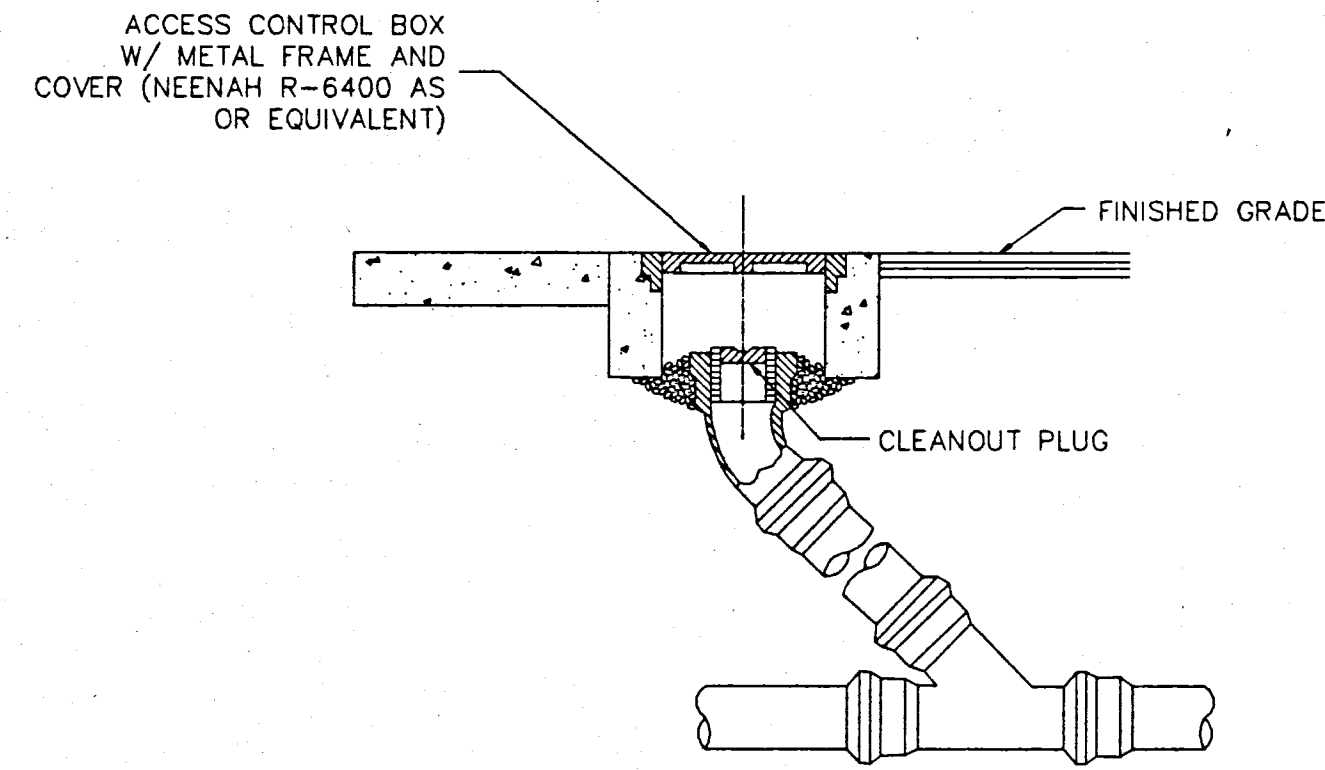


CLEANOUT IN PAVED AREA

NO SCALE

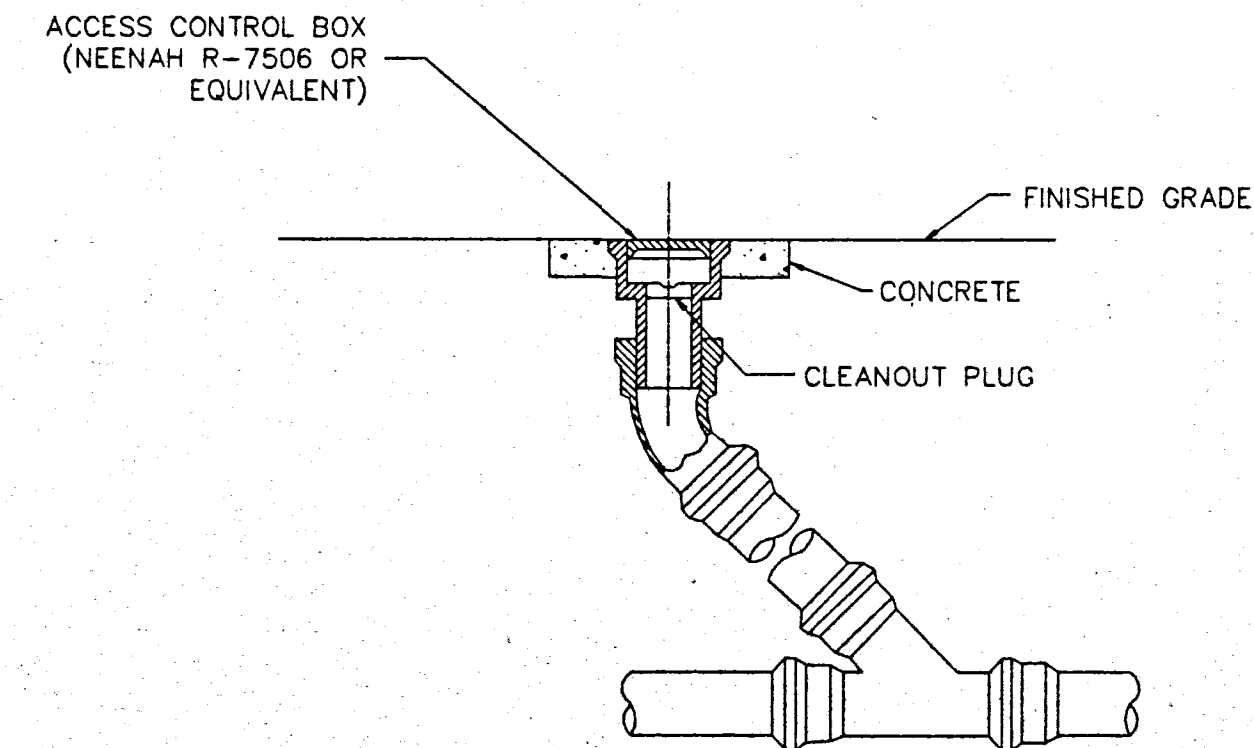

CLEANOUT IN UNPAVED AREA

NO SCALE

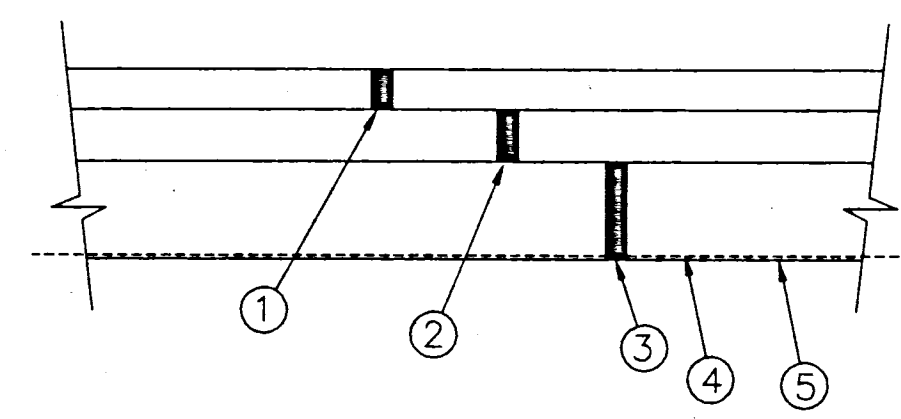


1. 1 1/2" ITEM 404 ASPHALT CONCRETE
2. 1 1/2" ITEM 402 ASPHALT CONCRETE
3. 8" ITEM 304 CRUSHED AGGREGATE BASE
4. TENSAR BX-1100 GEOGRID (OR APPROVED EQUAL)
5. ITEM 203 COMPACTED SUBBASE

STANDARD DUTY ASPHALT PAVEMENT DETAIL


SCALE: NONE

EXCAVATE/FILL TO REQUIRED SUB-BASE DESIGN ELEVATION AS PER REQUIREMENTS OF SPECIFICATIONS. SHOULD UNSATISFACTORY SOIL CONDITIONS EXIST, CONTRACTOR SHALL NOTIFY OWNER'S REPRESENTATIVE TO DETERMINE WHETHER OR NOT TO SEEK RECOMMENDATIONS OF A QUALIFIED SOILS ENGINEER. FAILURE OF THE CONTRACTOR TO MAKE SUCH NOTIFICATION SHALL IMPOSE THE BURDEN OF RESPONSIBILITY FOR ADEQUACY OF SOIL BEARING QUALITIES AND SUBSEQUENT DAMAGE UPON THE CONTRACTOR.

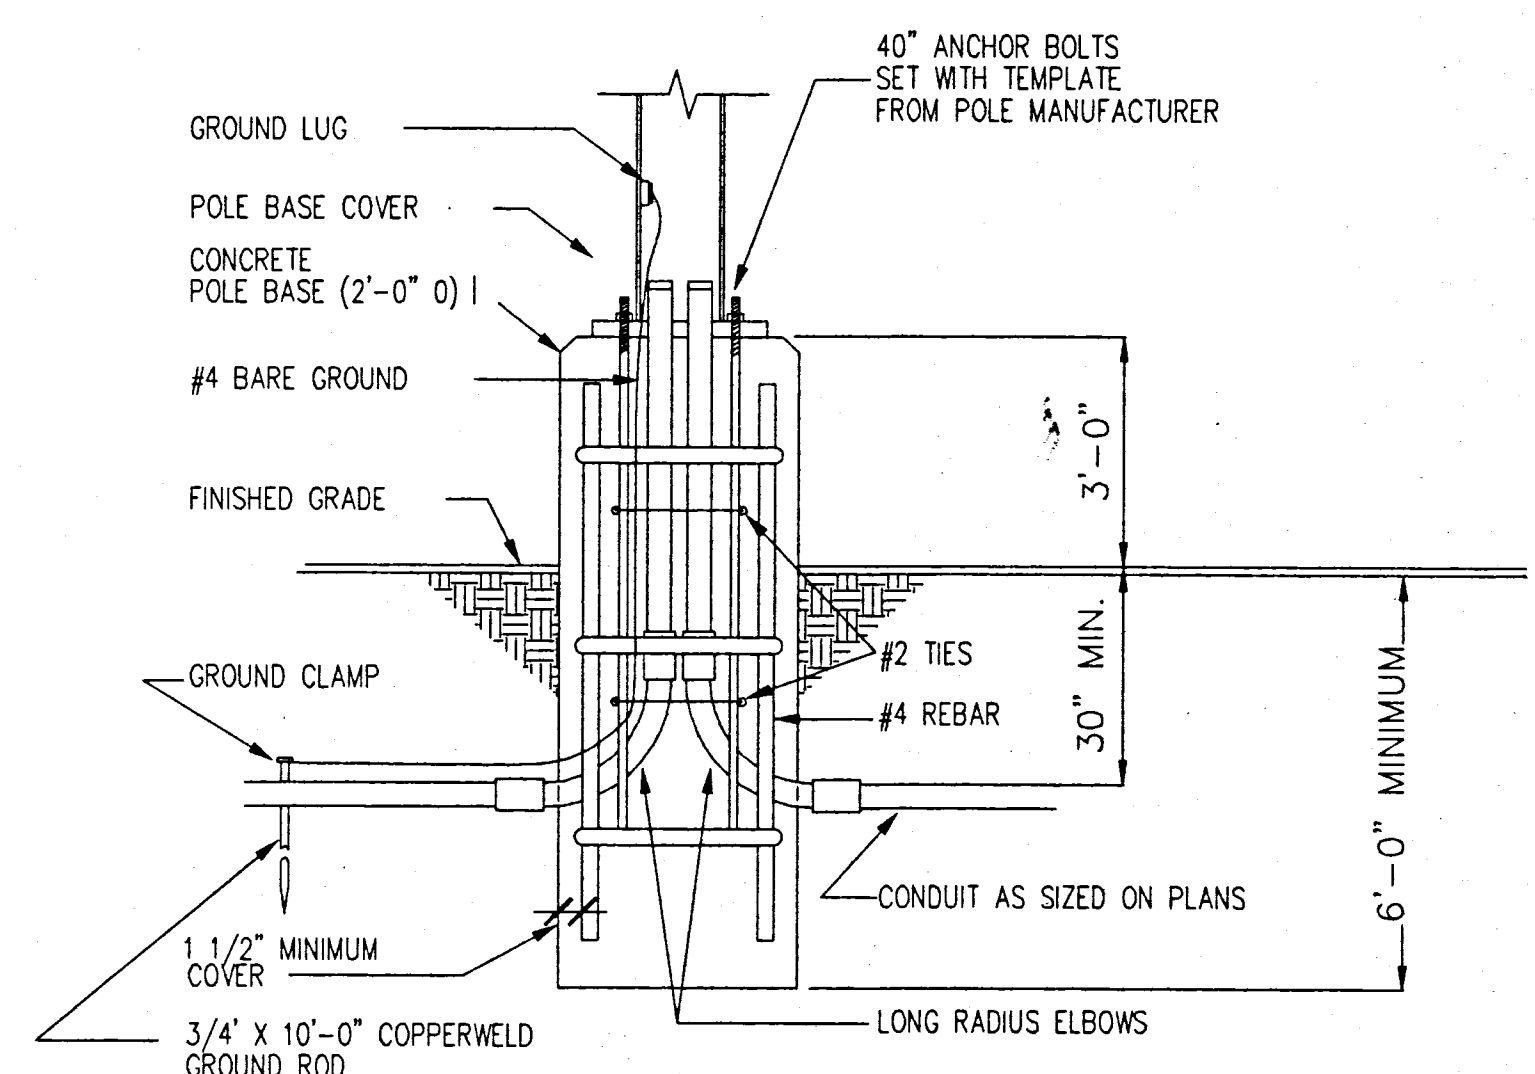

SITE LIGHTING POLE BASE DETAIL

SCALE: NONE

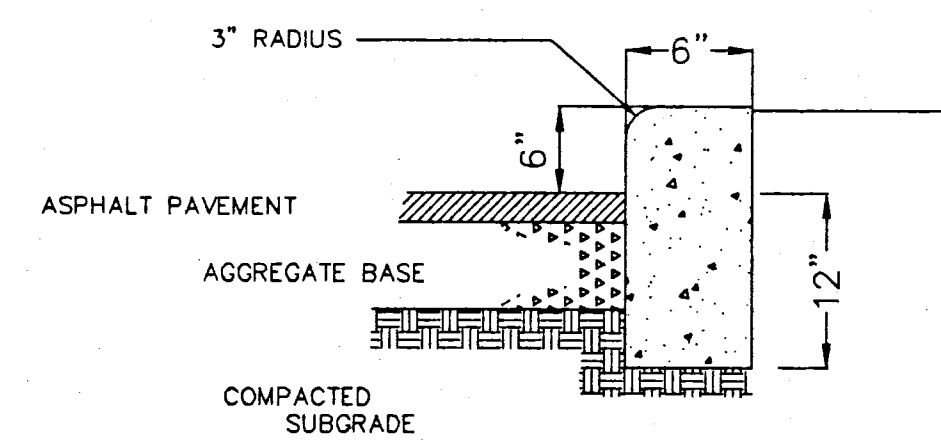

18" CONCRETE CURB DETAIL

SCALE: NONE

MISCELLANEOUS DETAIL
FOR
CVS PHARMACY

MAYSVILLE RD. & W. LA SALLE ST.
SOUTH ZANESVILLE
MUSKINGUM, CO. OHIO

DATE:
03 FEBRUARY, 1999

SHEET #
C-8

SYSTEMS, LTD.
SURVEYORS ENGINEERS
(614) 891-4970