



40-40-20-13-000 D

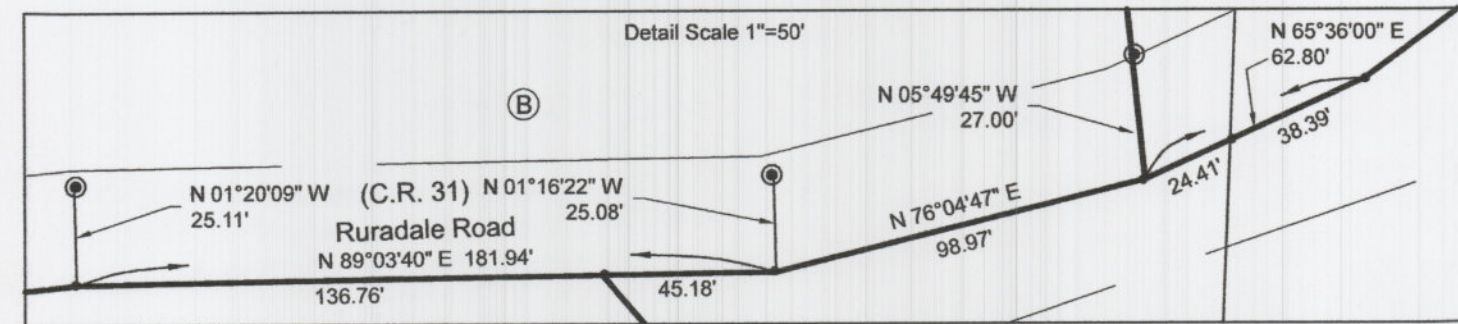

| CURVE | ARC LENGTH | RADIUS   | DELTA ANGLE | CHORD BEARING | CHORD LENGTH | TANGENT |
|-------|------------|----------|-------------|---------------|--------------|---------|
| C1    | 267.08'    | 1024.56' | 14°56'08"   | N 75°43'30" E | 266.32'      | 134.30' |
| C2    | 92.61'     | 1473.06' | 3°36'07"    | N 81°23'30" E | 92.59'       | 46.32'  |
| C3    | 370.27'    | 320.00'  | 66°17'48"   | N 75°23'54" E | 349.96'      | 208.99' |
| C4    | 333.02'    | 726.04'  | 26°16'50"   | N 71°00'50" W | 330.11'      | 169.49' |
| C5    | 299.93'    | 487.56'  | 35°14'46"   | N 75°29'48" W | 295.22'      | 154.88' |
| C6    | 595.43'    | 1293.00' | 26°23'06"   | S 73°41'19" W | 590.18'      | 303.09' |
| C7    | 293.99'    | 1959.15' | 8°35'52"    | S 49°33'30" W | 293.71'      | 147.27' |
| C8    | 371.86'    | 760.00'  | 28°02'02"   | S 67°52'27" W | 368.16'      | 189.73' |
| C9    | 208.84'    | 360.00'  | 33°14'19"   | N 81°29'23" W | 205.93'      | 107.45' |
| C10   | 238.82'    | 525.00'  | 26°03'47"   | N 77°54'07" W | 236.76'      | 121.51' |
| C11   | 189.93'    | 500.00'  | 21°45'52"   | S 78°13'36" W | 188.79'      | 96.12'  |
| C12   | 115.21'    | 500.00'  | 13°12'09"   | S 73°56'45" W | 114.96'      | 57.86'  |
| C13   | 138.41'    | 450.00'  | 17°37'25"   | S 89°21'32" W | 137.87'      | 69.76'  |
| C14   | 244.72'    | 800.00'  | 17°31'37"   | N 73°03'57" W | 243.77'      | 123.32' |
| C15   | 165.46'    | 250.00'  | 37°55'17"   | N 83°15'47" W | 162.46'      | 85.89'  |
| C16   | 443.49'    | 1293.00' | 19°39'08"   | S 77°03'15" W | 441.32'      | 223.95' |
| C17   | 151.94'    | 1293.00' | 6°43'58"    | S 63°51'45" W | 151.85'      | 76.06'  |
| C18   | 264.19'    | 1200.00' | 12°36'51"   | N 52°15'10" E | 263.66'      | 132.63' |

| LINE | BEARING       | DISTANCE |
|------|---------------|----------|
| L1   | S 87°31'00" E | 55.00'   |
| L2   | S 11°04'38" W | 82.33'   |
| L3   | S 03°54'02" W | 104.66'  |
| L4   | S 02°41'31" E | 120.62'  |
| L5   | S 07°04'04" E | 182.09'  |
| L6   | S 06°19'09" E | 234.72'  |
| L7   | S 63°30'35" W | 189.69'  |
| L8   | S 58°17'58" W | 140.39'  |
| L9   | S 52°25'53" W | 93.41'   |
| L10  | S 46°56'19" W | 145.49'  |
| L11  | N 76°02'48" E | 140.41'  |
| L12  | N 74°28'04" E | 111.84'  |
| L13  | N 80°49'18" E | 167.50'  |
| L14  | N 79°26'03" E | 211.88'  |
| L15  | N 65°36'00" E | 62.80'   |
| L16  | N 53°42'50" E | 57.85'   |
| L17  | N 05°49'45" W | 227.20'  |
| L18  | N 83°15'04" E | 104.81'  |
| L19  | N 89°03'40" E | 136.76'  |
| L20  | N 89°03'40" E | 45.18'   |
| L21  | N 89°03'40" E | 181.94'  |
| L22  | N 76°04'47" E | 98.97'   |

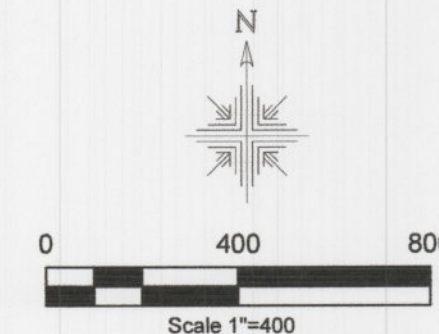

Meigs Township  
S.E. Qtr. Section 20  
S.W. & S.E. Qtr. Section 21  
N.W. Qtr. Section 28  
T-12 N; R-11 W  
Muskingum County, Ohio

SURVEYED FOR: Mossy Oak Properties/ Five Starr Farms LLC


REFERENCES:

Deeds as shown

Survey on file at Muskingum County Engineer's Office.

Basis of Bearing from Grid North, Ohio State Plane Coordinate System, South Zone, NAD 83.

Found in Tree

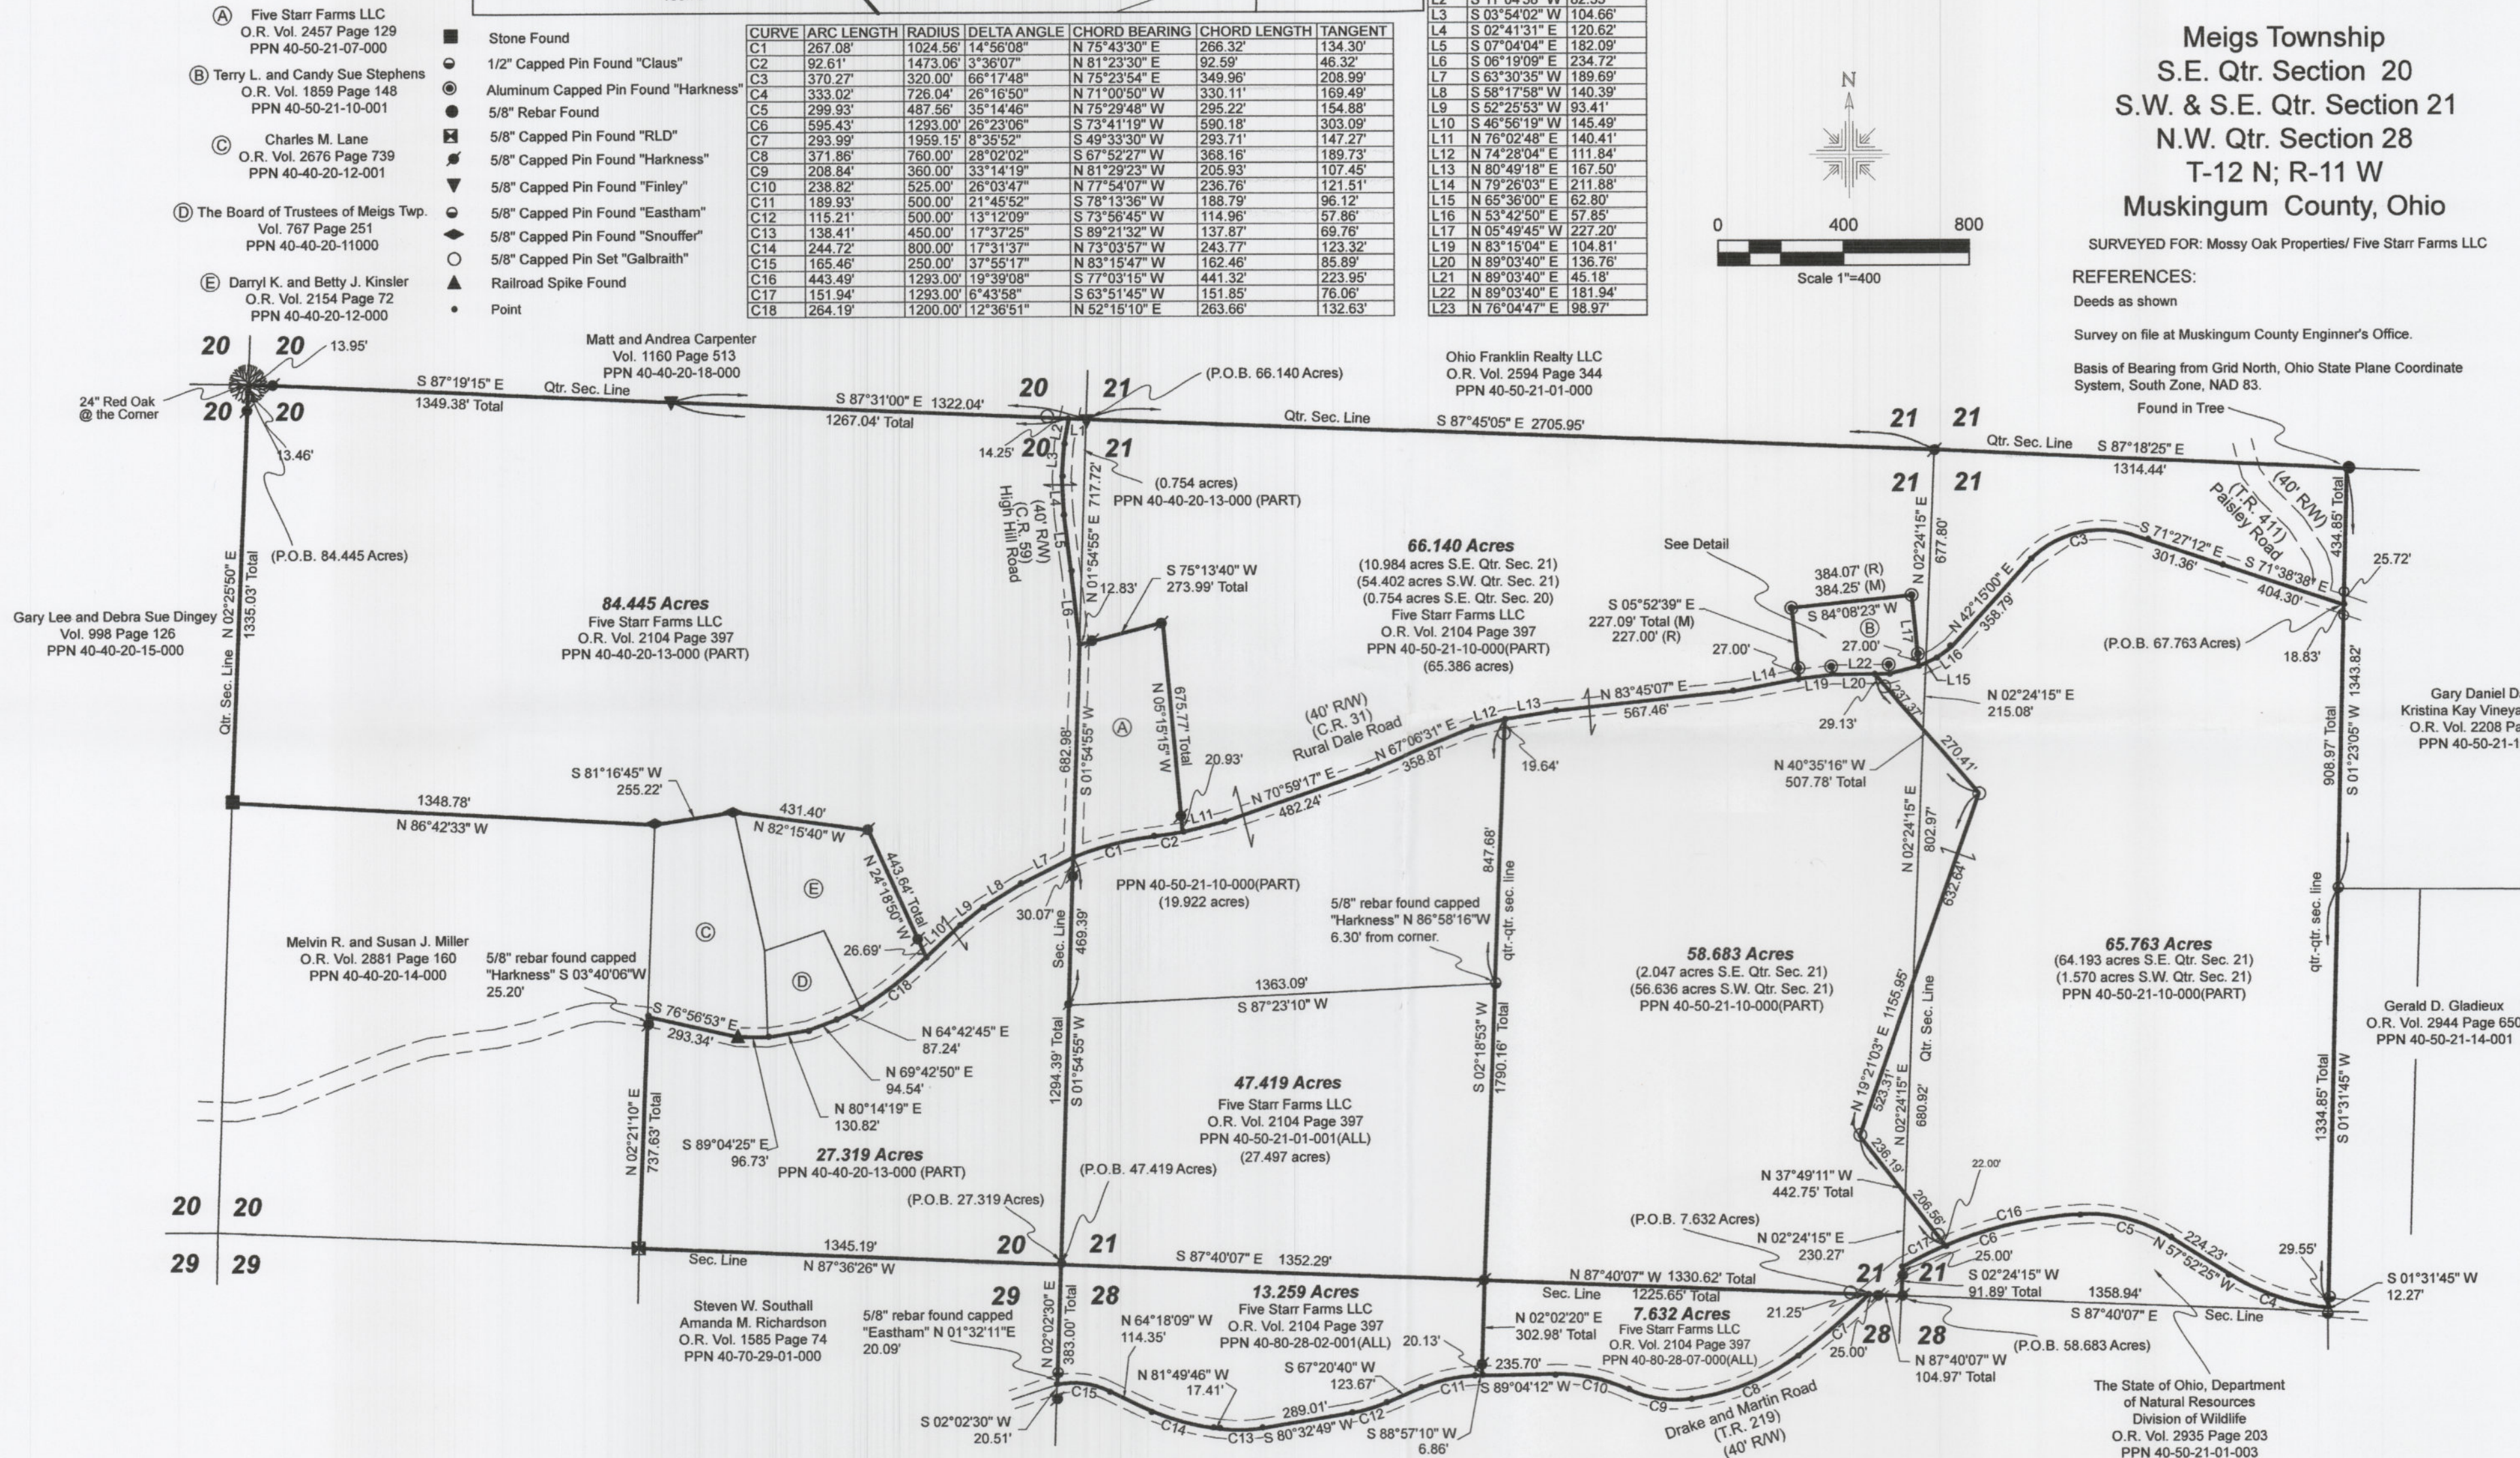

I certify this survey to be correct to the best of my knowledge.

**OFFICE COPY  
NOT RECORDABLE**

Caleb Jerome Galbraith  
Date: Feb 1, 2021  
Job ID: 1421

The State of Ohio, Department of Natural Resources  
Division of Wildlife  
O.R. Vol. 2935 Page 203  
PPN 40-80-28-02-000

Pioneer Surveying & Services, LLC.  
5434 Township Road 377  
Millersburg, Ohio 44654  
Phone: 330-231-0497  
Email: caleb@pioneersurveyingandservices.com



DESCRIPTION  
APPROVED  
By: *[Signature]*