

17-51-03-27-000 A

SITUATED IN

The State of Ohio, County of Muskingum
Township of Falls, Qtr. Twp. 3. T1. R8
and being part of Lot 10 and Lot 11 in Monroe-Duncan Sub., DR "P"-519.

BASIS OF BEARING

Bearings & distances are based on State Plane Grid Coordinates,
NAD83, Ohio South, per GPS Observation.

REFERENCES

* As Noted on Plat
www.muskingumcountyauditor.org
www.mceo.org
http://recorder.
muskingumcounty.org

DESCRIPTION
APPROVED

By: *[Signature]*

LINE TABLE


LINE	BEARING	DISTANCE
L1	N 74°31'26" E	127.43'
L2	N 71°42'05" E	94.68'
L3	N 68°34'03" E	105.57'
L4	S 23°17'09" E	100.00'
L5	N 66°42'51" E	134.31'
L6	S 02°20'24" W	416.58'
L7	N 02°20'24" E	234.38'
L8	N 66°42'51" E	65.69'
L9	N 23°17'09" W	100.00'
L10	N 65°50'31" E	121.51'
L11	S 11°34'26" E	541.51'
L12	N 62°44'17" W	281.11'
L13	S 62°44'17" E	130.08'
L14	S 29°28'13" W	233.19'
L15	N 49°40'27" W	131.99'
L16	N 29°22'10" E	203.32'



This plat was prepared by McPeck Land Surveying, LLC
in accordance with Chapter 4733-37 of the Administrative Code,
and is intended to be used for the legal transfer of the property
described and does not intend to describe all or any easements of
record, nor encroachments unless otherwise intended.

Reduced copy, not to scale, Larger
copy available in the Muskingum
County Engineer's Map Dept.

OFFICE COPY
NOT RECORDABLE
Date: *11/21/20*
Reg. Surveyor No. 8517

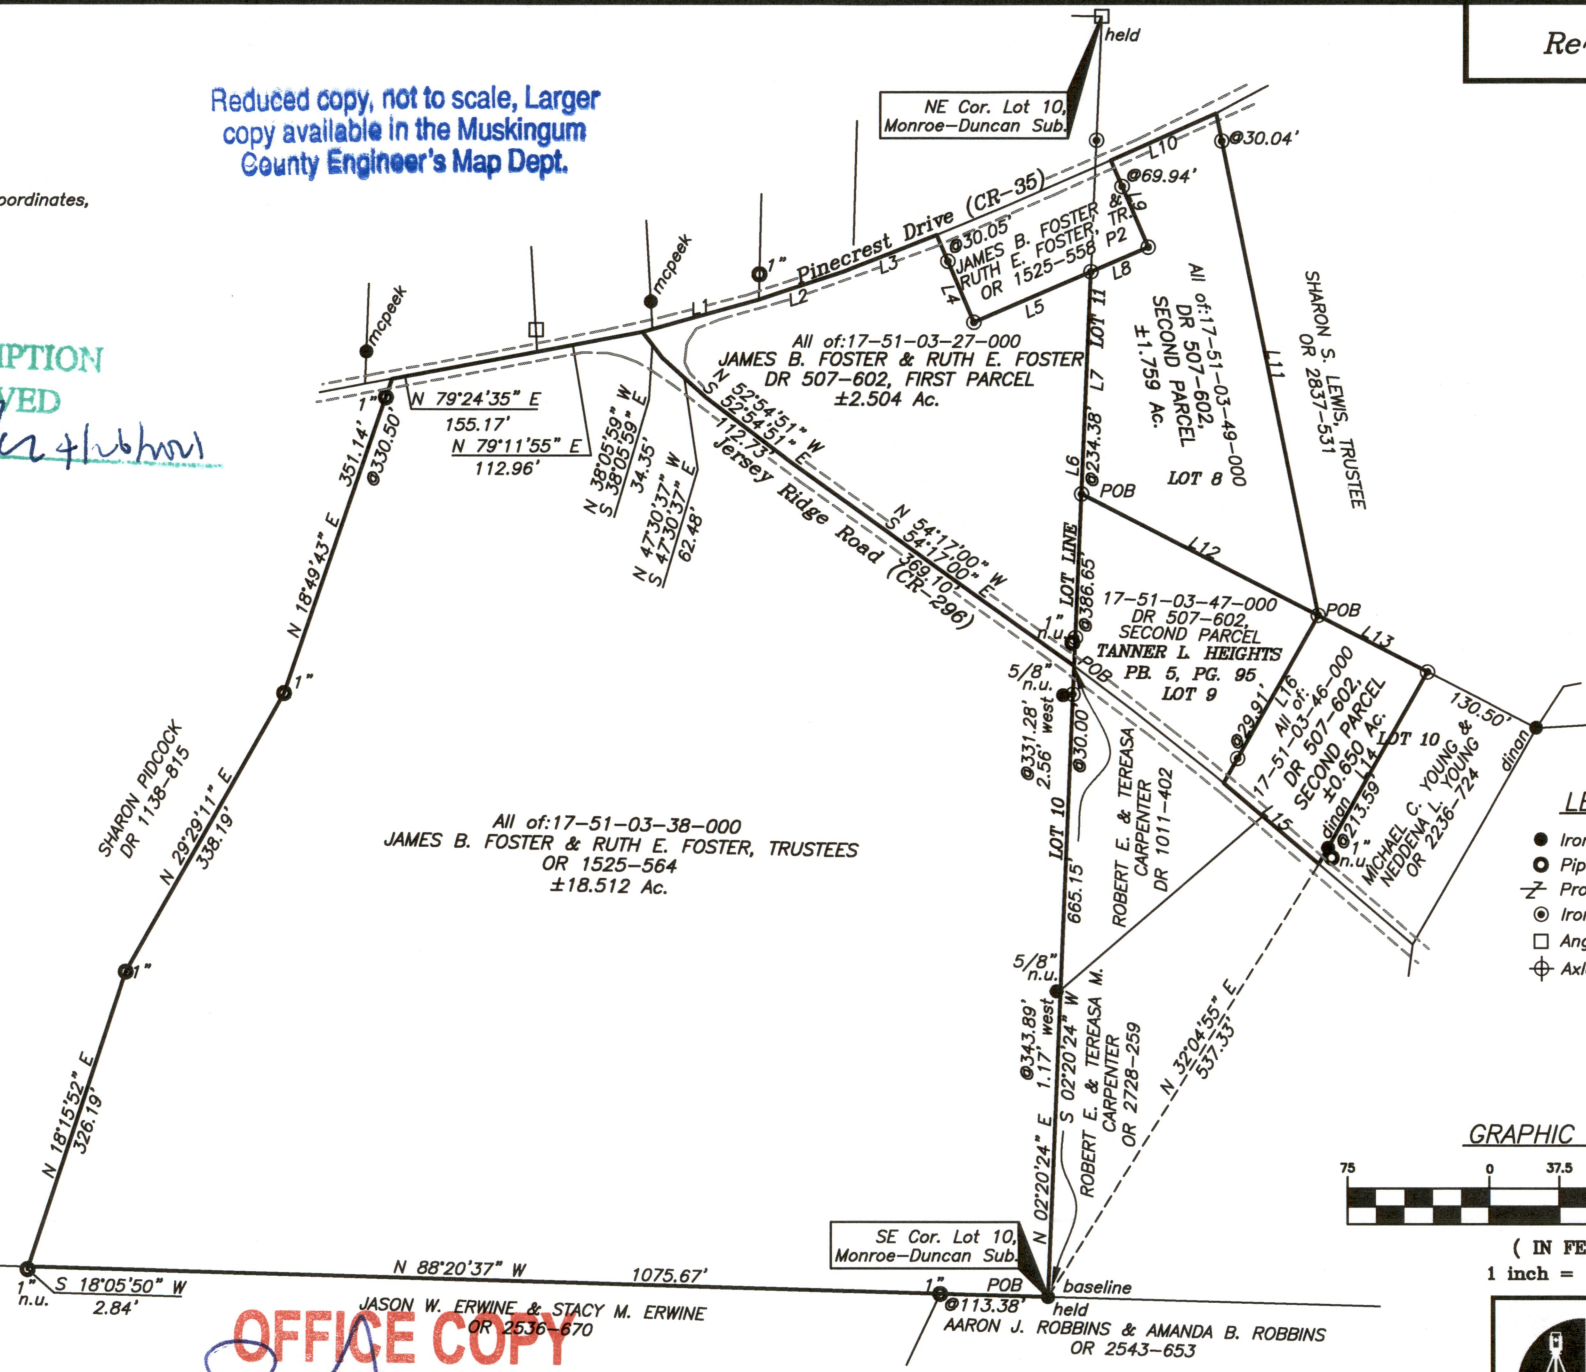


Re~Survey



LEGEND

- Iron Pin Found
- Pipe Found w/cap
- Z- Property Hook
- ⊙ Iron Pin Set
- Angle Iron
- ⊕ Axle Found

GRAPHIC SCALE

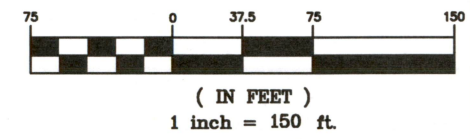

MCPECK LAND SURVEYING
LLC
www.mcpecklandsurveying.com
email: brian@mcpecklandsurveying.com
340 Robin Hood Ln., * Zanesville, Oh 43701 * 740.704.6073